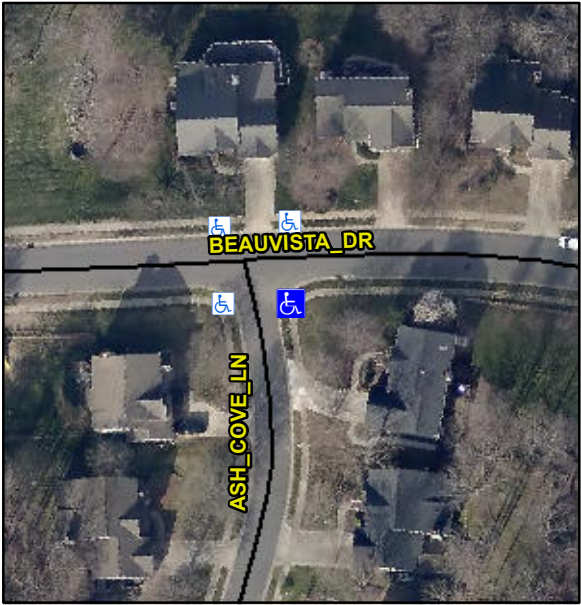


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2769	Main Street: ASH_COVE_LN	Cross Street: BEAUVISTA_DR	Location: SE
ADA ID: D893D8298892	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		No	Ramp Length (in)	48.0
			No	Ramp Width (in)	44.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2</p>			To N	X Walk 2 Direction	To W
			N/A	X Walk 1 Width (in)	N/A
			5.8	X Walk 1 Slope (%)	0.3
			3.0	X Walk 1 X Slope (%)	1.9
			N/A	Ramp inside XWalk1?	N/A
			1.5	Road Slope (%)	N/A
			1.2	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	BEAUVISTA DR
Stop Condition-Street 2	None
Street 2 Name	ASH COVE LN
Stop Condition-Street 1	StopSign

Total Cost: \$ 3200.00

