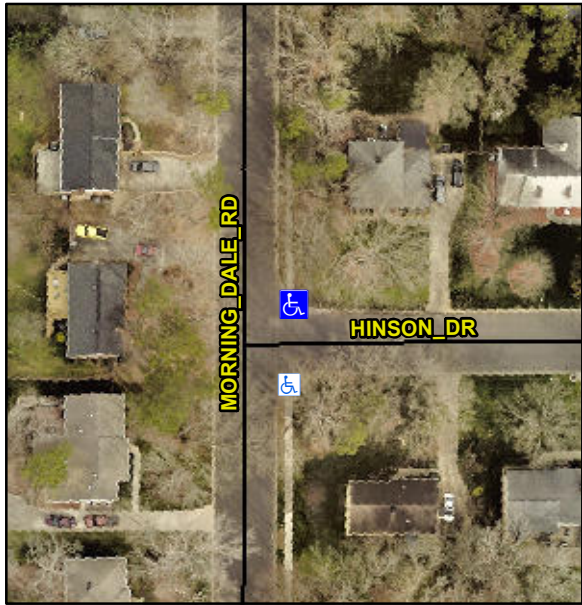


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 22245	Main Street: HINSON_DR	Cross Street: MORNING_DALE_RD	Location: NE
ADA ID: D9450431A064	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

		Possible Solutions:		Compliance		Description		Data	Compliance		Description		Data
		Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	64.0	No	Ramp Slope (%)	11.6				
				Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	5.2				
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A				
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A				
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A				
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A				
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A				
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A				
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A				
Surveyor Notes:  N/A   PROW/ADA:  R304.2.2, R304.5.3		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A						
		N/A	Shared Landing?	N/A									
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A						
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A						
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A						
			X Walk 1 Direction	To SW		X Walk 2 Direction	N/A						
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A						
			X Walk 1 Slope (%)	0.9		X Walk 2 Slope (%)	N/A						
			X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A						
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A						
Total Cost: \$ 1850.00			Road Slope (%)	N/A	N/A	Clear Space?	N/A						
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A						
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A						
			Obstruction Type			Storm Grate/Utility Type							
					N/A		N/A						
					Yes	Surface Condition? (G/P)	Good						

