

Access Compliance Report Public Rights-of-Way (Curb Ramps)



8.8 1.8 N/A N/A N/A N/A N/A N/A

> N/A N/A N/A N/A N/A N/A N/A

> N/A


Good

Surface Condition? (G/P)

Intersection ID: 10020275Main Street: AYRSLEY_TOWN_BVCross Street: N/ALocation: NWADA ID: D94610E284D9Ramp Type: PerpInitial Pass/Fail: FailOverall Compliance: NoSeverity Score: 12.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

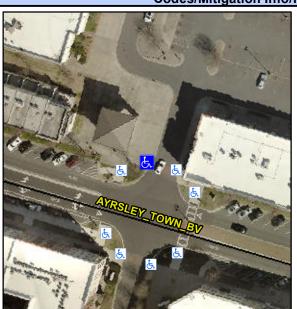

| | 1 |
|-------------------------|----------|
| Street 1 Name | ENTRANCE |
| Stop Condition-Street 2 | StopSign |
| Street 2 Name | N/A |
| Stop Condition-Street 1 | N/A |

| Possible Solution | | Field Measurements/Component Compnance | | | | | | |
|------------------------------|------------|--|-----------------------|-------|-----------|---------------------------|--|--|
| Possible Solutions: | | Comp | liance Description | Data | Compliand | e Description | | |
| Remove & Replace Entire Ramp |) . | N/A | Ramp Length (in) | 95.0 | No Ra | amp Slope (%) | | |
| | | Yes | Ramp Width (in) | 48.0 | Yes Ra | amp XSlope (%) | | |
| | | N/A | Flare Type LT | N/A | N/A FI | are Type RT | | |
| | | N/A | Flare Slope LT (%) | N/A | N/A FI | are Slope RT (%) | | |
| | | N/A | Flare Traversable LT? | N/A | N/A FI | are Traversable RT? | | |
| | | N/A | Landing Length (in) | N/A | N/A D | NS Provided? | | |
| Surveyor Notes: | | N/A | Landing Width (in) | N/A | N/A D | NS Contrast? | | |
| N/A | | N/A | Landing Slope (%) | N/A | N/A D | NS Length (in) | | |
| 4 | | N/A | Landing X Slope (%) | N/A | N/A D | NS Full Width? | | |
| | | N/A | Landing Curb? (Y/N) | N/A | N/A D | NS Offset (in) | | |
| | | N/A | Shared Landing? | N/A | | | | |
| PROW/ADA: | | N/A | Gutter Ponding? | N/A | N/A G | utter Slope (%) | | |
| R304.2.2 | | N/A | Gutter Lip Ht (in) | N/A | N/A G | utter X Slope (%) | | |
| | | N/A | Painted X Walk1? | No | N/A Pa | ainted X Walk2? | | |
| | | | X Walk 1 Direction | To SE | Х | Walk 2 Direction | | |
| | | N/A | X Walk 1 Width (in) | N/A | N/A X | Walk 2 Width (in) | | |
| | | | X Walk 1 Slope (%) | 1.0 | Х | Walk 2 Slope (%) | | |
| | | | X Walk 1 X Slope (%) | 3.3 | Х | Walk 2 X Slope (%) | | |
| | | N/A | Ramp inside XWalk1? | N/A | N/A R | amp inside XWalk2? | | |
| | | | Road Slope (%) | N/A | N/A CI | ear Space? | | |
| | | | Road X Slope (%) | N/A | N/A CI | ear Space to XWalk (in) | | |
| | | N/A | Any Obstructions? | N/A | N/A St | orm Grate/Utility Hazard? | | |
| Total Cost: \$ | 1850.00 | | Obstruction Type | | St | orm Grate/Utility Type | | |
| | | | | N/A | | | | |





