


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|   |                            |   |                        |
|---|----------------------------|---|------------------------|
| Intersection ID: 10273                  | Main Street: SWEETBRIAR_ST | Cross Street: THE_PLAZA                 | Location: SW           |
| ADA ID: D9C144D2A40C                    | Ramp Type: Para            | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Severity Score: 0                       |                            |   |                        |
| Codes/Mitigation Info/Possible Solution |                            | Field Measurements/Component Compliance |                        |

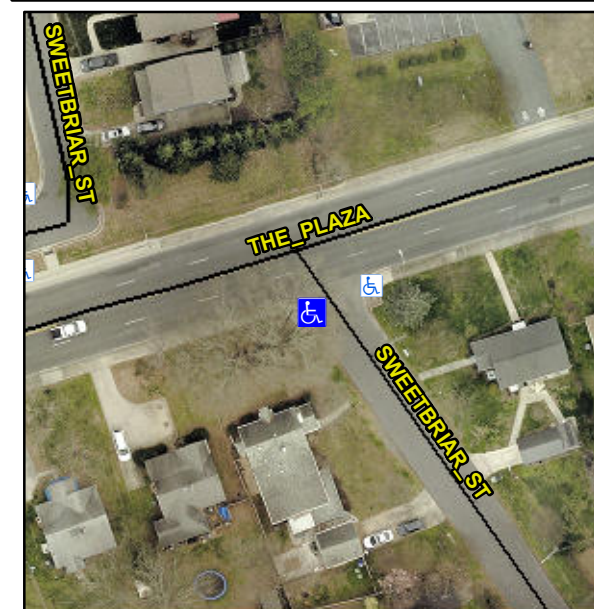

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R305.2**

Total Cost:

**\$ 1600.00**

| Compliance | Description          | Data | Compliance | Description                 | Data |
|------------|----------------------|------|------------|-----------------------------|------|
| N/A        | Ramp Length LT (in)  | N/A  | N/A        | Ramp Length RT (in)         | 35.5 |
| N/A        | Ramp Width LT (in)   | N/A  | Yes        | Ramp Width RT (in)          | 71.0 |
| N/A        | Ramp Slope LT (%)    | N/A  | Yes        | Ramp Slope RT (%)           | 8.0  |
| N/A        | Ramp XSlope LT (%)   | N/A  | Yes        | Ramp XSlope RT (%)          | 0.5  |
| Yes        | Landing Length (in)  | 71.0 | Yes        | DWS Provided?               | Yes  |
| Yes        | Landing Width (in)   | 72.0 | Yes        | DWS Contrast?               | Yes  |
| Yes        | Landing Slope (%)    | 0.4  | Yes        | DWS Length (in)             | 24.0 |
| Yes        | Landing X Slope (%)  | 1.2  | Yes        | DWS Full Width?             | Yes  |
| N/A        | Landing Curb? (Y/N)  | Yes  | No         | DWS Offset (in)             | 2.5  |
| N/A        | Shared Landing?      | No   |            |                             |      |
| Yes        | Gutter Ponding?      | No   | Yes        | Gutter Slope (%)            | 1.0  |
| Yes        | Gutter Lip Ht (in)   | 0.0  | Yes        | Gutter X Slope (%)          | 0.6  |
| N/A        | Painted X Walk1?     | No   | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction   | To E |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)  | N/A  | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)   | 3.0  |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%) | 1.1  |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?  | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)       | N/A  | N/A        | Clear Space?                | Yes  |
|            | Road X Slope (%)     | N/A  | N/A        | Clear Space to XWalk (in)   | N/A  |
| Yes        | Any Obstructions?    | No   | Yes        | Storm Grate/Utility Hazard? | No   |
|            | Obstruction Type     |      |            | Storm Grate/Utility Type    |      |
|            |                      | N/A  |            |                             | N/A  |
|            |                      |      | Yes        | Surface Condition? (G/P)    | Good |
|            |                      |      | N/A        | Curb Slope (%)              | 11.4 |

