


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 10662	Main Street: E_36TH_ST	Cross Street: HOLT_ST	Location: S
ADA ID: DA47B9D5989B	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 12.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

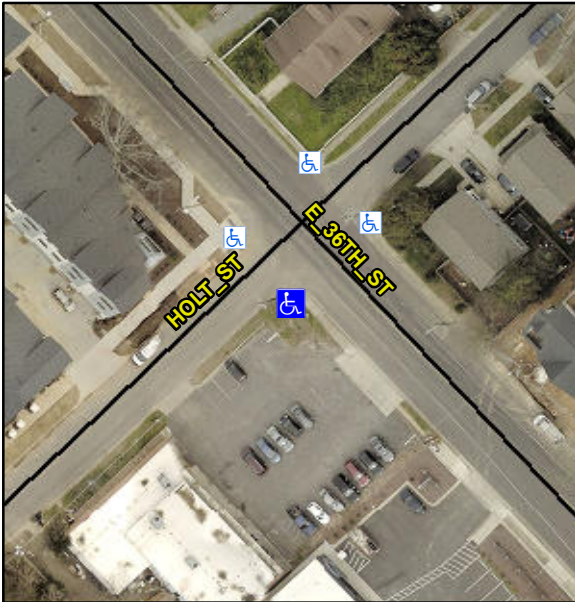

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7.2, R304.5.4

Street 1 Name	E 36TH ST
Stop Condition-Street 1	None
Street 2 Name	HOLT ST
Stop Condition-Street 2	StopSign

Total Cost: \$ **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	40.0	N/A	Ramp Length RT (in)	25.5
Yes	Ramp Width LT (in)	59.0	Yes	Ramp Width RT (in)	59.0
Yes	Ramp Slope LT (%)	6.3	Yes	Ramp Slope RT (%)	2.0
No	Ramp XSlope LT (%)	2.1	Yes	Ramp XSlope RT (%)	1.8
Yes	Landing Length (in)	59.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.1	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	3.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	9.4
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	4.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	1.1
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.4	N/A	Clear Space?	Yes
	Road X Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	20.9

