


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: FREEDOM_DR	Cross Street: N_I-85_RA	Location: N
ADA ID: DB1E64E8C722	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

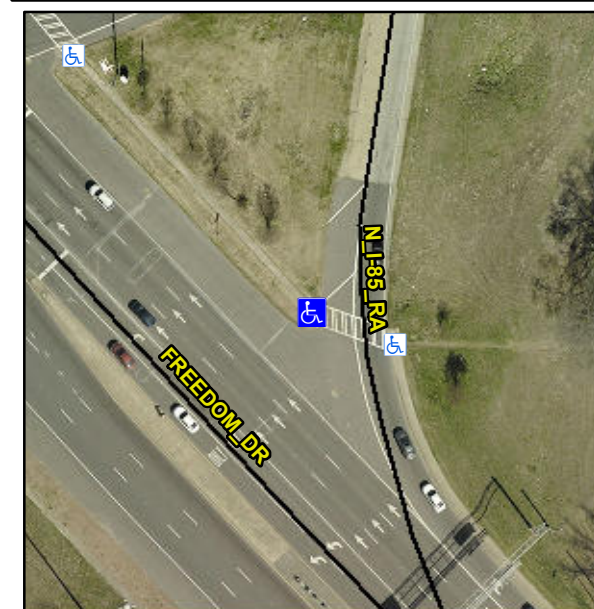

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.2, R302.7.2

Total Cost:

\$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	60.0	Yes	Grade Break Slope (%)	0.8
Yes	Ramp Slope (%)	1.4	No	Grade Break XSlope (%)	3.1
No	Ramp XSlope (%)	3.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	61.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	3.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	48.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	5.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.3
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.4
N/A	Painted X Walk1?	Yes		Road Slope (%)	1.7
	X Walk 1 Direction	To SE		Road X Slope (%)	2.3
	X Walk 1 Width (in)	116.0		Clear Space?	Yes
	X Walk 1 Slope (%)	1.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.3	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.5

