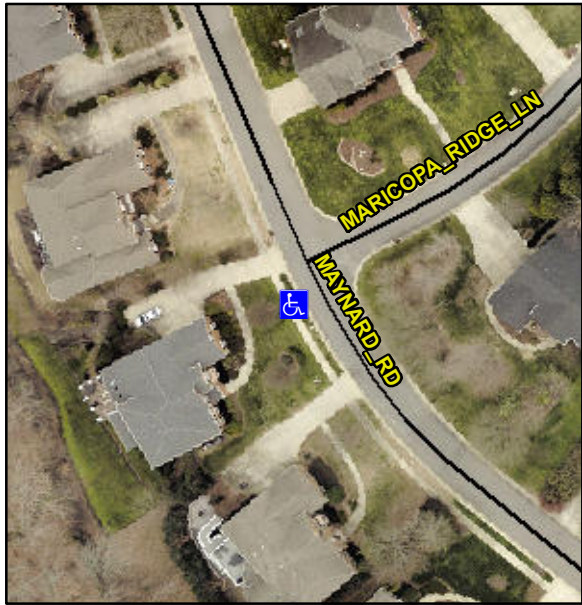


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                      |                         |                                  |                        |
|----------------------|-------------------------|----------------------------------|------------------------|
| Intersection ID: N/A | Main Street: MAYNARD_RD | Cross Street: MARICOPIA_RIDGE_LN | Location: SW           |
| ADA ID: DC04B3F1BB19 | Ramp Type: Perp         | Initial Pass/Fail: Fail          | Overall Compliance: No |
|                      |                         | Severity Score: 10               |                        |

| Codes/Mitigation Info/Possible Solution  |                               |            | Field Measurements/Component Compliance |                       |  |             |  |     |                             |            |      |  |             |  |  |      |
|--|-------------------------------|------------|---|-----------------------|--|-------------|--|-----|-----------------------------|------------|------|--|-------------|--|--|------|
|  | Possible Solutions:           |            | Compliance                              |                       |  | Description |  |     | Data                        | Compliance |      |  | Description |  |  | Data |
|  | Remove & Replace Entire Ramp. |            | N/A                                     | Ramp Length (in)      |  | 48.0        |  | Yes | Ramp Slope (%)              |            | 5.0  |  |             |  |  |      |
|  |                               |            | No                                      | Ramp Width (in)       |  | 44.3        |  | Yes | Ramp XSlope (%)             |            | 3.3  |  |             |  |  |      |
|  |                               |            | N/A                                     | Flare Type LT         |  | N/A         |  | N/A | Flare Type RT               |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Flare Slope LT (%)    |  | N/A         |  | N/A | Flare Slope RT (%)          |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Flare Traversable LT? |  | N/A         |  | N/A | Flare Traversable RT?       |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Landing Length (in)   |  | N/A         |  | N/A | DWS Provided?               |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Landing Width (in)    |  | N/A         |  | N/A | DWS Contrast?               |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Landing Slope (%)     |  | N/A         |  | N/A | DWS Length (in)             |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Landing X Slope (%)   |  | N/A         |  | N/A | DWS Full Width?             |            | N/A  |  |             |  |  |      |
| Surveyor Notes:  |                               | N/A        | N/A                                     | Landing Curb? (Y/N)   |  | N/A         |  | N/A | DWS Offset (in)             |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Shared Landing?       |  | N/A         |  |     |                             |            |      |  |             |  |  |      |
| PROW/ADA:  |                               | R304.5.1   | N/A                                     | Gutter Ponding?       |  | N/A         |  | N/A | Gutter Slope (%)            |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Gutter Lip Ht (in)    |  | N/A         |  | N/A | Gutter X Slope (%)          |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Painted X Walk1?      |  | No          |  | N/A | Painted X Walk2?            |            | N/A  |  |             |  |  |      |
|  |                               |            |   | X Walk 1 Direction    |  | To E        |  |     | X Walk 2 Direction          |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | X Walk 1 Width (in)   |  | N/A         |  | N/A | X Walk 2 Width (in)         |            | N/A  |  |             |  |  |      |
|  |                               |            |   | X Walk 1 Slope (%)    |  | 3.2         |  |     | X Walk 2 Slope (%)          |            | N/A  |  |             |  |  |      |
|  |                               |            |   | X Walk 1 X Slope (%)  |  | 3.5         |  |     | X Walk 2 X Slope (%)        |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Ramp inside XWalk1?   |  | N/A         |  | N/A | Ramp inside XWalk2?         |            | N/A  |  |             |  |  |      |
|  |                               |            |   | Road Slope (%)        |  | N/A         |  | N/A | Clear Space?                |            | N/A  |  |             |  |  |      |
|  |                               |            |   | Road X Slope (%)      |  | N/A         |  | N/A | Clear Space to XWalk (in)   |            | N/A  |  |             |  |  |      |
|  |                               |            | N/A                                     | Any Obstructions?     |  | N/A         |  | N/A | Storm Grate/Utility Hazard? |            | N/A  |  |             |  |  |      |
|  |                               |            |   | Obstruction Type      |  |             |  |     | Storm Grate/Utility Type    |            |      |  |             |  |  |      |
|  |                               |            |   |                       |  |             |  | N/A |                             |            | N/A  |  |             |  |  |      |
|  |                               |            |   |                       |  |             |  | Yes | Surface Condition? (G/P)    |            | Good |  |             |  |  |      |
| Total Cost:  |                               | \$ 1850.00 |   |                       |  |             |  |     |                             |            |      |  |             |  |  |      |

