

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 27490 Main Street: BALLANTYNE\_COMMONS\_PY Cross Street: JOHNSTON\_RD Location: NE

ADA ID: DC3797F50DB0 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

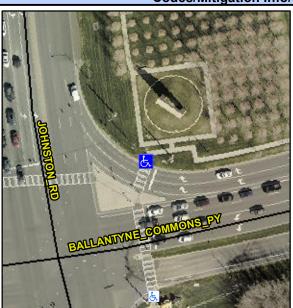

Street 1 Name	BALLANTYNE COMMONS PY
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solution	
Possible Solutions:	9
Remove & Replace Entire Ramp.	
	١
	N
	N
	N
	1
Surveyor Notes:	1
N/A	1
	1
	1
	1
PROW/ADA:	1
R304.2.2	N
	N
	N

Total Cost:	\$ 1850.00

Comp	liance Description	Data	Comp	liance Description	Data
N/A	Ramp Length (in)	72.0	No	Ramp Slope (%)	9.4
Yes	Ramp Width (in)	59.0	Yes	Ramp XSlope (%)	1.8
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	120.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good





