


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10019921Main Street: ARDREY_KELL_RDCross Street: N/ALocation:NEADA ID: DC50BBE8E9B1Ramp Type: BlendTrans1Initial Pass/Fail: FailOverall Compliance: NoSeverity Score: 8.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

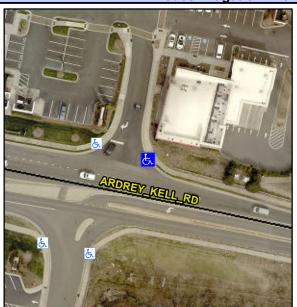

Street 1 Name ENTRANCE
Stop Condition-Street 1 StopSign
Street 2 Name N/A
Stop Condition-Street 2 N/A

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

No Ramp Width (in)
No Ramp Width



Total Cost:



3200.00

Compliance Description		Data	Comp	liance Description	Data
N/A	Ramp Length (in)	26.0	Yes	BlendTrans Slope (%)	4.5
No	Ramp Width (in)	46.0	Yes	BlendTrans XSlope (%)	1.5
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.7		Clear Space?	N/A
	Road X Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
Alexander and the second			No	Curb Slope (%)	16.7