

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12492	Main Street: S_COLLEGE_ST	Cross Street: E_4TH_ST	Location: W
ADA ID: DC9072EC637A	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 0.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

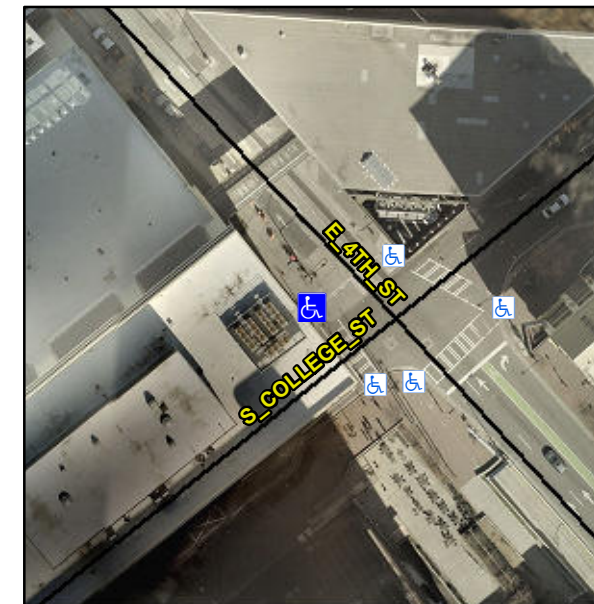

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.2, R207.1

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	65.0	Yes	BlendTrans Slope (%)	1.0
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	3.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.5	N/A	Flare Slope RT (%)	2.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	25.0
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	108.0		X Walk 2 Width (in)	110.0
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	0.1
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	0.3
Yes	Ramp inside XWalk1?	Yes	No	Ramp inside XWalk2?	No
	Road Slope (%)	0.4		Clear Space?	Yes
	Road X Slope (%)	1.2	Yes	Clear Space to XWalk (in)	48.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.2

Street 1 Name S COLLEGE ST

Stop Condition-Street 1 Signal

Street 2 Name E 4TH ST

Stop Condition-Street 2 Signal

