


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 23663	Main Street: S_TRYON_ST	Cross Street: ERWIN_RD	Location: W
ADA ID: DC9A039D5F64	Ramp Type: MedianPerp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

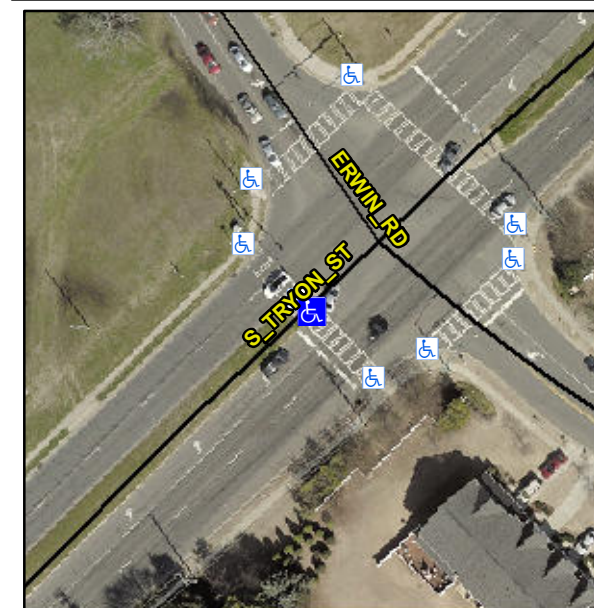

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4**

Total Cost: \$ 1650.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	44.0	Yes	Ramp Slope (%)	6.7
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.8	N/A	Flare Slope RT (%)	2.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.9	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.1	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	120.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

