

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 15882Main Street: EAST_BVCross Street: QUEENS_RD_WESTLocation:NEADA ID: DCBD3F4A2CD0Ramp Type: PerpInitial Pass/Fail: FailOverall Compliance: NoSeverity Score: 13.75

Codes/Mitigation Info/Possible Solution

Total Cost:

Field Measurements/Component Compliance

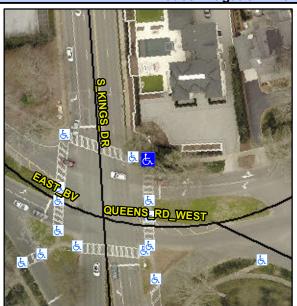

Street 1 Name	EAST BV
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

ossible Solution	
Possible Solutions:	Compl
Remove & Replace Entire Ramp.	N/A
•	Yes
	N/A
	N/A
	N/A
	N/A
Surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
PROW/ADA:	N/A
R304.2.2, R304.5.3	N/A
	N/A
	N/A
	N/A



1850.00

Comp	liance Description	Data	Comp	liance Description	Data
N/A	Ramp Length (in)	50.0	No	Ramp Slope (%)	9.2
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good