


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12080	Main Street: E_15TH_ST	Cross Street: SEIGLE_AV	Location: W
ADA ID: DD4407A29D23	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 30			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

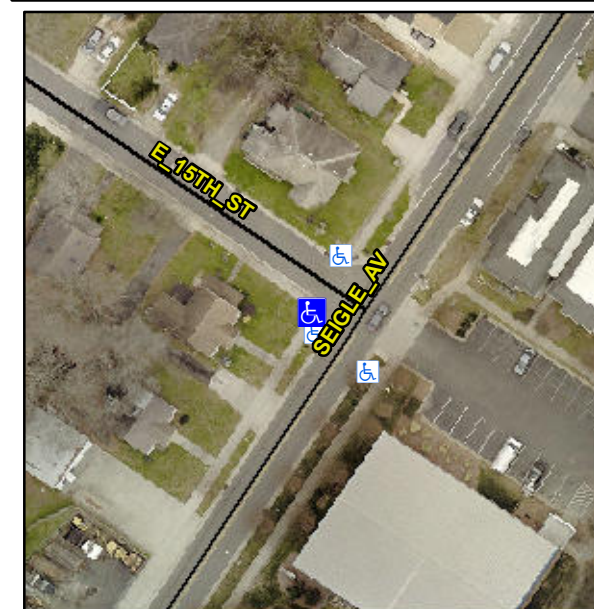

Possible Solutions:

Install Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R302.7.2, R304.5.4

Total Cost: \$ 1150.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84.0	Yes	Ramp Slope (%)	5.6
Yes	Ramp Width (in)	49.0	Yes	Ramp XSlope (%)	0.6
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	Yes	Flare Slope RT (%)	6.8
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.2
No	Gutter Lip Ht (in)	2.5	Yes	Gutter X Slope (%)	1.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name E 15TH ST
 Stop Condition-Street 2 StopSign
 Street 2 Name N/A
 Stop Condition-Street 1 N/A

