


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10038086Main Street: SIKES_PLCross Street: N/ALocation:SEADA ID: DD69C9D1CB60Ramp Type: PerpInitial Pass/Fail: FailOverall Compliance: NoSeverity Score: 12.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

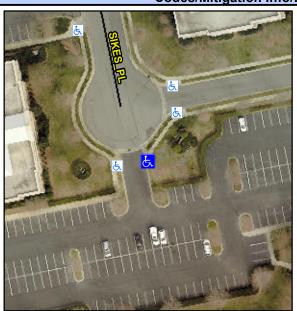

	A SECTION AND ADDRESS OF THE PARTY OF THE PA
Street 1 Name	ENTRANCE
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:					
Remove & Replace Entire Ramp.					
Surveyor Notes:					
N/A					
PROW/ADA:					
R304.2.2					

Total Cost:	\$ 1850.00

Field Measurements/Component Compilance							
Comp	liance Description	Data	Comp	liance Description	Data		
N/A	Ramp Length (in)	45.0	No	Ramp Slope (%)	8.7		
Yes	Ramp Width (in)	49.0	Yes	Ramp XSlope (%)	0.0		
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type		l	Storm Grate/Utility Type			
		N/A			N/A		
			Yes	Surface Condition? (G/P)	Good		
T-W	Sec. 1						





