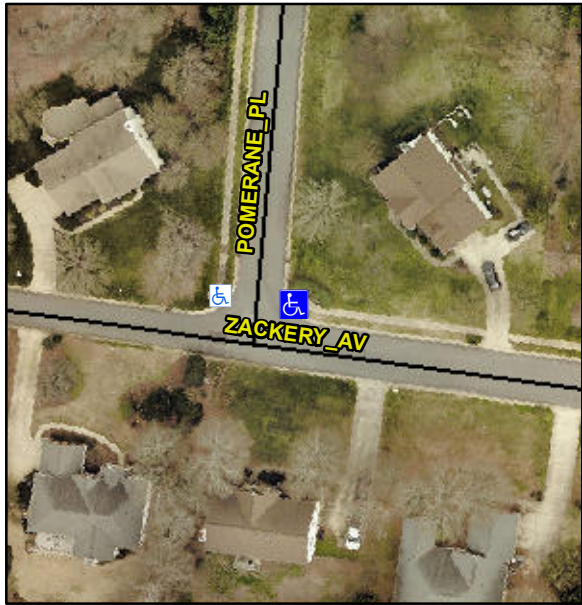


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 28311	Main Street: POMERANE_PL	Cross Street: ZACKERY_AV	Location: NE
ADA ID: DD8F258AEA7D	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length (in)	41.0	Yes	Ramp Slope (%)	6.2
			Yes	Ramp Width (in)	80.0	No	Ramp XSlope (%)	2.6
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	3.4	Yes	Flare Slope RT (%)	2.4
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	54.0	No	DWS Provided?	No
			Yes	Landing Width (in)	80.0	N/A	DWS Contrast?	No
			No	Landing Slope (%)	4.0	N/A	DWS Length (in)	N/A
			Yes	Landing X Slope (%)	1.6	N/A	DWS Full Width?	No
		N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	No				
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.8	
		Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.2	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To NW		X Walk 2 Direction	To S	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	5.1		X Walk 2 Slope (%)	1.5	
			X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	3.2	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	3.0	N/A	Clear Space?	Yes	
			Road X Slope (%)	6.7	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	

