


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13097	Main Street: BEAUMONT_AV	Cross Street: SUNNYSIDE_AV	Location: SW
ADA ID: DDA716ACC6D2	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

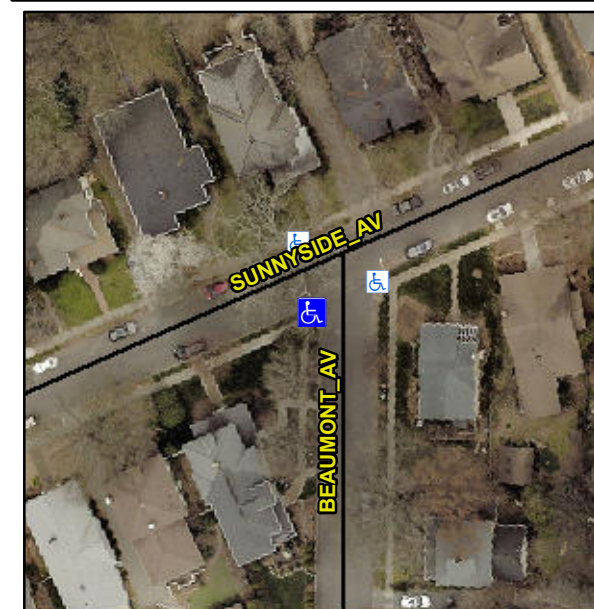

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	53.0	Yes	Ramp Slope (%)	5.7
Yes	Ramp Width (in)	60.0	No	Ramp XSlope (%)	2.1
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	49.0	No	DWS Provided?	No
Yes	Landing Width (in)	61.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.5	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.2	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.7
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.6		X Walk 2 Slope (%)	1.9
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	3.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8	N/A	Clear Space?	Yes
	Road X Slope (%)	5.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **BEAUMONT AV**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **SUNNYSIDE AV**
 Stop Condition-Street 1 **None**

