

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 21461	Main Street: FOREST_POINT_BV	Cross Street: W_ARROWWOOD_RD	Location: N
ADA ID: DDC85C335B4F	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 46.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

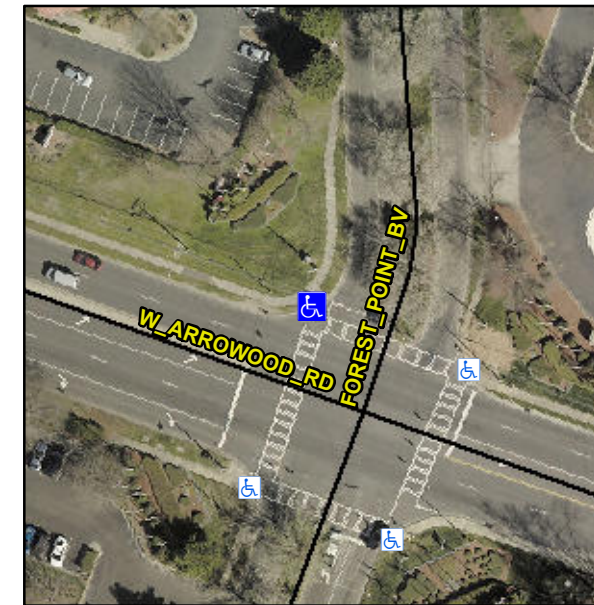

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2, R304.5.3

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	123.0	No	Ramp Slope (%)	9.2
No	Ramp Width (in)	39.0	No	Ramp XSlope (%)	11.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	111.0	N/A	X Walk 2 Width (in)	85.0
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	4.4
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	2.6
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	No
	Road Slope (%)	5.4	N/A	Clear Space?	N/A
	Road X Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **W ARROWOOD RD**
 Stop Condition-Street 2 **Signal**
 Street 2 Name **FOREST POINT BV**
 Stop Condition-Street 1 **Signal**

