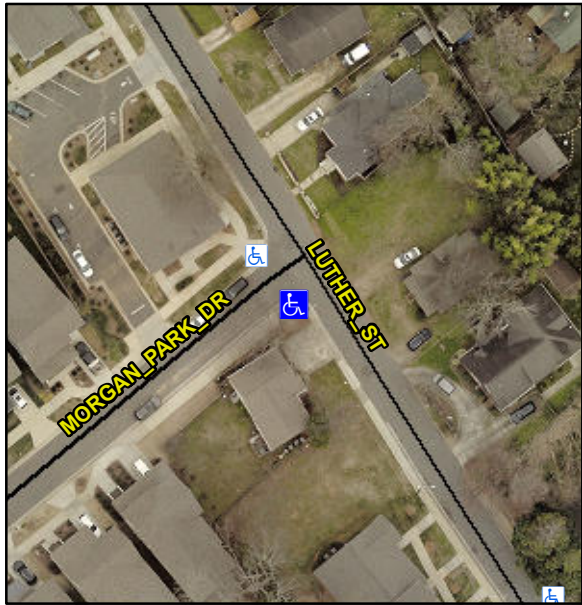


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 53405	Main Street: LUTHER_ST	Cross Street: MORGAN_PARK_DR	Location: S
ADA ID: DE34D48E8531	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length LT (in)	60.0	N/A	Ramp Length RT (in)	34.0
			No	Ramp Width LT (in)	37.0	Yes	Ramp Width RT (in)	71.0
			No	Ramp Slope LT (%)	13.0	Yes	Ramp Slope RT (%)	6.9
			Yes	Ramp XSlope LT (%)	0.2	Yes	Ramp XSlope RT (%)	1.6
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Surveyor Notes:								
N/A								
PROW/ADA:								
R304.5.1, R304.3.2								
Total Cost:		\$	3200.00		N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	5.2
Street 1 Name		LUTHER ST						
Stop Condition-Street 1		None						
Street 2 Name		MORGAN PARK DR						
Stop Condition-Street 2		StopSign						

Street 1 Name	LUTHER ST
Stop Condition-Street 1	None
Street 2 Name	MORGAN PARK DR
Stop Condition-Street 2	StopSign

