


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18038	Main Street: INWOOD_DR	Cross Street: MURRAYHILL_RD	Location: SW
ADA ID: DE410CBE939C	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 17.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

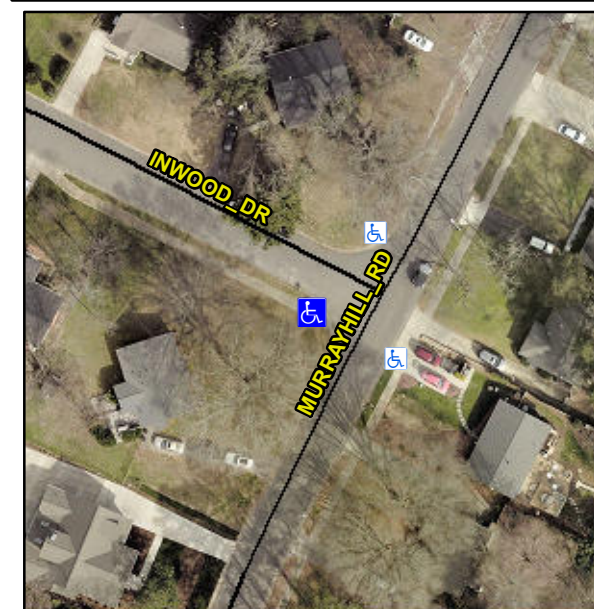

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R304.2.2-Perp, R304.3.2-
Para, R305.1.4, R305.2, R302.7.2**

Street 1 Name	MURRAYHILL RD
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ **1800.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	36.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	70.0	Yes	Grade Break Slope (%)	2.6
Yes	Ramp Slope (%)	6.1	Yes	Grade Break XSlope (%)	0.7
No	Ramp XSlope (%)	2.7			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.9	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	85.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	27.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	No		Road Slope (%)	0.6
	X Walk 1 Direction	To E		Road X Slope (%)	0.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	19.5

