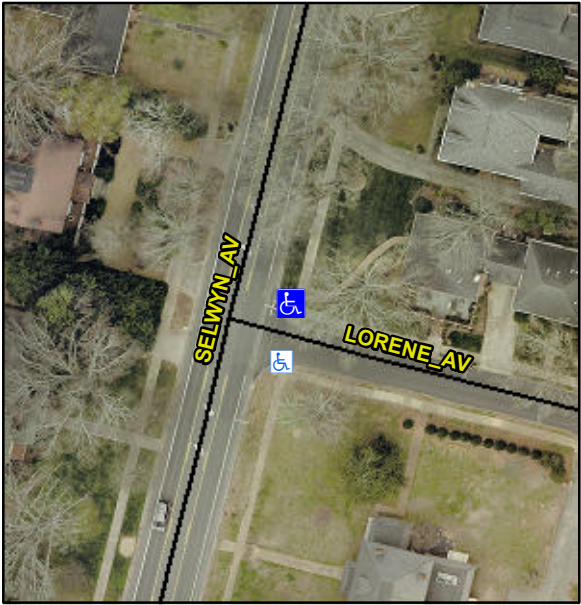


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 17743	Main Street: LORENE_AV	Cross Street: SELWYN_AV	Location: NE
ADA ID: DEF50E9F296F	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	75.0	N/A
			Yes	Ramp Width (in)	62.0	N/A
			No	Ramp Slope (%)	8.6	N/A
			No	Ramp XSlope (%)	3.1	N/A
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	0.0	N/A
			N/A	Landing Width (in)	0.0	N/A
			N/A	Landing Slope (%)	0.0	N/A
			N/A	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	0.0	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To S	N/A
				X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	4.4	N/A
				X Walk 1 X Slope (%)	4.7	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		N/A
					Yes	N/A
					N/A	N/A
					Yes	Good
					N/A	15.2
Surveyor Notes:						
N/A						
PROW/ADA:						
R304.2.2, R304.5.3						
Total Cost:			\$	1600.00		

Street 1 Name	LORENE AV
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

