

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

N/A

N/A

N/A

N/A

10.2

5.9

N/A

N/A

N/A

N/A

N/A

N/A

N/A

23.5

Intersection ID: 13754 Main Street: S\_MCDOWELL\_ST Cross Street: BAXTER\_ST Location: SE

ADA ID: DEFF97B7EFFB Ramp Type: Combination2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 25

Compliance Description

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

N/A

Yes

No

No

N/A

Yes

N/A

N/A

N/A

N/A

N/A

N/A

N/A

**Codes/Mitigation Info/Possible Solution** 

Field Measurements/Component Compliance

N/A

N/A

N/A

N/A

Nο

No

N/A

N/A

N/A

N/A

N/A

N/A

N/A N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

Curb Slope (%)

Flare Traversable RT?

Flare Type RT

Ramp XSlope RT (%)

Data

62.0

52.0

9.4

3.1

30.0

54.0

N/A


N/A

N/A

N/A

N/A

N/A

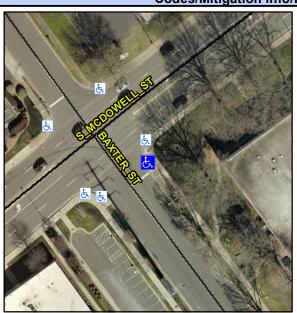

Street 1 Name
StopSign
Stop Condition-Street 1
BAXTER ST
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3, R304.3.2





Total Cost:



1600.00

N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
No.	THE THE		N/A	Any Obstruction?	N/A
No.				Obstruction Type	
					N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	
HE.					N/A
			Yes	Surface Condition? (G/P)	Good
Marine Comment					