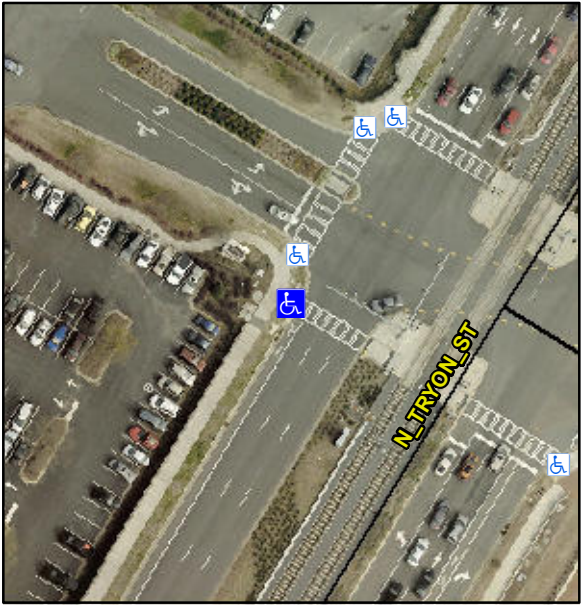


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 51491	Main Street: N_TRYON_ST	Cross Street: INSTITUTE_CR	Location: W
ADA ID: DF0B6F22E41C	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	96.0
			N/A	Ramp Width (in)	65.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	1.5
			N/A	Painted X Walk1?	No
			N/A	X Walk 1 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 1 Slope (%)	1.9
			N/A	X Walk 1 X Slope (%)	3.9
<p>Total Cost: \$ 1850.00</p>			N/A	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			N/A	X Walk 2 Slope (%)	N/A
			N/A	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	N/A
<p>Street 1 Name N TRYON ST</p> <p>Stop Condition-Street 2 Signal</p> <p>Street 2 Name N/A</p> <p>Stop Condition-Street 1 N/A</p>			N/A	Surface Condition? (G/P)	Good
			N/A		

