


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 20326	Main Street: MONTPELIER_RD	Cross Street: WEDGEDALE_DR	Location: W
ADA ID: DF26CE8DC8A9	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

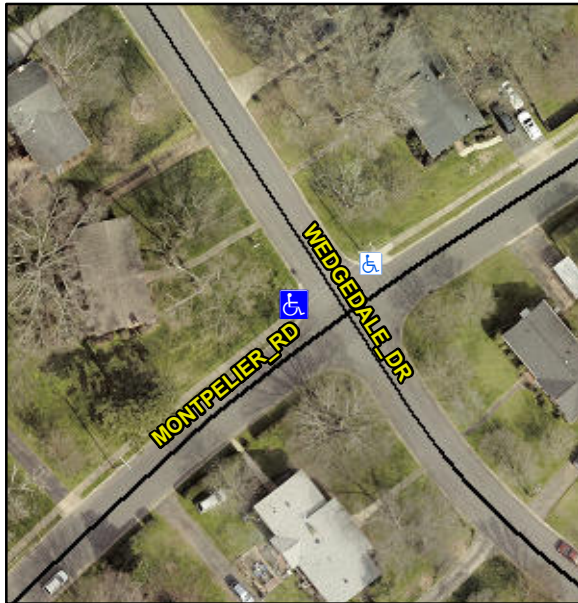

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

CURB LIP 1.0

PROW/ADA:

Not Found, R304.5.3, R305.1.4, R305.2

Street 1 Name **MONTPELIER RD**
 Stop Condition-Street 1 **None**
 Street 2 Name **WEDGEDALE DR**
 Stop Condition-Street 2 **StopSign**

Total Cost: \$ **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	BlendTrans Slope (%)	0.8
Yes	Ramp Width (in)	56.0	No	BlendTrans XSlope (%)	4.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	8.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	5.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.5		X Walk 2 Slope (%)	0.5
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	6.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.4		Clear Space?	Yes
	Road X Slope (%)	6.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	6.3

