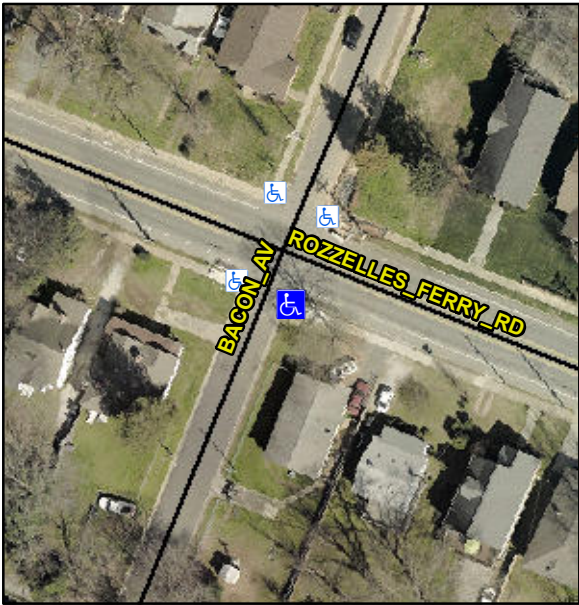


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10319	Main Street: BACON_AV	Cross Street: ROZZELLES_FERRY_RD	Location: SE
ADA ID: DF9DEF7AAC9F	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 35	

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			N/A	Ramp Length (in)	62.0	Yes	Ramp Slope (%)	6.6
				No	Ramp Width (in)	24.0	Yes	Ramp XSlope (%)	0.1
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	N/A
			N/A	Shared Landing?	N/A				
PROW/ADA:			N/A	Gutter Ponding?	N/A	N/A	N/A	Gutter Slope (%)	N/A
Not Found, R304.5.1			N/A	Gutter Lip Ht (in)	N/A	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To NE			X Walk 2 Direction	To NW
			N/A	X Walk 1 Width (in)	N/A	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	9.2			X Walk 2 Slope (%)	0.2
				X Walk 1 X Slope (%)	1.6			X Walk 2 X Slope (%)	0.5
Street 1 Name			ROZZELLES FERRY RD	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Stop Condition-Street 2			None		Road Slope (%)	0.5	N/A	Clear Space?	N/A
Street 2 Name			BACON AV		Road X Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
Stop Condition-Street 1			StopSign	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type				Storm Grate/Utility Type	
						N/A			N/A
						Yes		Surface Condition? (G/P)	Good
Total Cost:			\$ 3200.00						

