


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7523	Main Street: COTTONWOOD_ST	Cross Street: N_GRAHAM_ST	Location: E
ADA ID: DFD05346A23A	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 2.75			

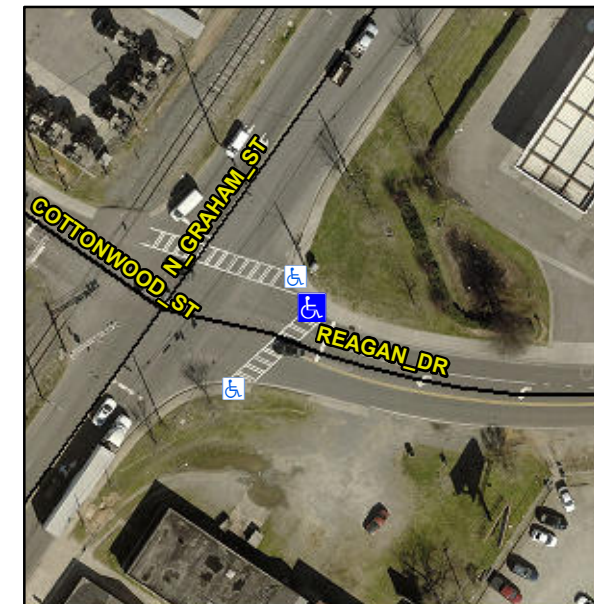

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.1.4, R305.2

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	63.5	N/A	Ramp Length RT (in)	66.0
Yes	Ramp Width LT (in)	71.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	6.5	Yes	Ramp Slope RT (%)	5.4
No	Ramp XSlope LT (%)	2.6	Yes	Ramp XSlope RT (%)	1.8
Yes	Landing Length (in)	71.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	50.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.8
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	25.4

