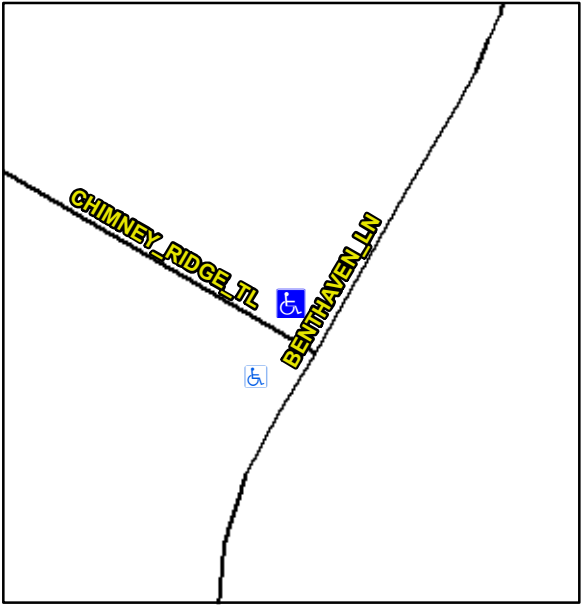


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 3909	Main Street: BENTHAVEN_LN	Cross Street: CHIMNEY_RIDGE_TL	Location: NW
ADA ID: DFF8FECA2E67	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance																																																																																																																																																							
 <p>Street 1 Name: CHIMNEY RIDGE TL</p> <p>Stop Condition-Street 1: StopSign</p> <p>Street 2 Name: N/A</p> <p>Stop Condition-Street 2: N/A</p>		<p>Possible Solutions:</p> <p><b>Remove &amp; Replace Entire Ramp.</b></p> <p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>R304.2.2, R304.5.3</b></p>																																																																																																																																																							
		<table> <thead> <tr> <th>Compliance</th><th>Description</th><th>Data</th><th>Compliance</th><th>Description</th><th>Data</th></tr> </thead> <tbody> <tr> <td>N/A</td><td>Ramp Length (in)</td><td>48.0</td><td>N/A</td><td>Grade Break?</td><td>N/A</td></tr> <tr> <td>Yes</td><td>Ramp Width (in)</td><td>48.0</td><td>N/A</td><td>Grade Break Slope (%)</td><td>0.0</td></tr> <tr> <td>No</td><td>Ramp Slope (%)</td><td>12.9</td><td>N/A</td><td>Grade Break XSlope (%)</td><td>0.0</td></tr> <tr> <td>No</td><td>Ramp XSlope (%)</td><td>4.1</td><td></td><td></td><td></td></tr> <tr> <td>N/A</td><td>Flare Type LT</td><td>N/A</td><td>N/A</td><td>Flare Type RT</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Flare Slope LT (%)</td><td>N/A</td><td>N/A</td><td>Flare Slope RT (%)</td><td>0.0</td></tr> <tr> <td>N/A</td><td>Flare Traversable LT?</td><td>N/A</td><td>N/A</td><td>Flare Traversable RT?</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Landing Length (in)</td><td>0.0</td><td>N/A</td><td>DWS Provided?</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Landing Width (in)</td><td>0.0</td><td>N/A</td><td>DWS Contrast?</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Landing Slope (%)</td><td>0.0</td><td>N/A</td><td>DWS Length (in)</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Landing X Slope (%)</td><td>0.0</td><td>N/A</td><td>DWS Full Width?</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Landing Curb? (Y/N)</td><td>N/A</td><td>N/A</td><td>DWS Offset LT (in)</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Shared Landing?</td><td>N/A</td><td>N/A</td><td>DWS Offset RT (in)</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Gutter Ponding?</td><td>0.0</td><td>N/A</td><td>Gutter Slope (%)</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Gutter Lip Ht (in)</td><td>0.0</td><td>N/A</td><td>Gutter X Slope (%)</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Painted X Walk1?</td><td>No</td><td></td><td>Road Slope (%)</td><td>8.3</td></tr> <tr> <td></td><td>X Walk 1 Direction</td><td>To E</td><td></td><td>Road X Slope (%)</td><td>3.6</td></tr> <tr> <td></td><td>X Walk 1 Width (in)</td><td>N/A</td><td></td><td>Clear Space?</td><td>N/A</td></tr> <tr> <td></td><td>X Walk 1 Slope (%)</td><td>8.3</td><td>N/A</td><td>Clear Space to XWalk (in)</td><td>N/A</td></tr> <tr> <td></td><td>X Walk 1 X Slope (%)</td><td>3.6</td><td>N/A</td><td>Storm Grate/Utility Hazard?</td><td>N/A</td></tr> <tr> <td>N/A</td><td>Ramp inside XWalk1?</td><td>N/A</td><td></td><td>Storm Grate/Utility Type</td><td></td></tr> <tr> <td>N/A</td><td>Any Obstructions?</td><td>N/A</td><td></td><td></td><td>N/A</td></tr> <tr> <td></td><td>Obstruction Type</td><td></td><td>Yes</td><td>Surface Condition? (G/P)</td><td>Good</td></tr> <tr> <td></td><td></td><td></td><td>N/A</td><td>Curb Slope (%)</td><td>7.1</td></tr> </tbody> </table>				Compliance	Description	Data	Compliance	Description	Data	N/A	Ramp Length (in)	48.0	N/A	Grade Break?	N/A	Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0	No	Ramp Slope (%)	12.9	N/A	Grade Break XSlope (%)	0.0	No	Ramp XSlope (%)	4.1				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A	N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A	N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A	N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A	N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A	N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A	N/A	Painted X Walk1?	No		Road Slope (%)	8.3		X Walk 1 Direction	To E		Road X Slope (%)	3.6		X Walk 1 Width (in)	N/A		Clear Space?	N/A		X Walk 1 Slope (%)	8.3	N/A	Clear Space to XWalk (in)	N/A		X Walk 1 X Slope (%)	3.6	N/A	Storm Grate/Utility Hazard?	N/A	N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type		N/A	Any Obstructions?	N/A			N/A		Obstruction Type		Yes	Surface Condition? (G/P)	Good				N/A
Compliance	Description	Data	Compliance	Description	Data																																																																																																																																																				
N/A	Ramp Length (in)	48.0	N/A	Grade Break?	N/A																																																																																																																																																				
Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0																																																																																																																																																				
No	Ramp Slope (%)	12.9	N/A	Grade Break XSlope (%)	0.0																																																																																																																																																				
No	Ramp XSlope (%)	4.1																																																																																																																																																							
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A																																																																																																																																																				
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0																																																																																																																																																				
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A																																																																																																																																																				
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A																																																																																																																																																				
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A																																																																																																																																																				
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A																																																																																																																																																				
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A																																																																																																																																																				
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A																																																																																																																																																				
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A																																																																																																																																																				
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A																																																																																																																																																				
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A																																																																																																																																																				
N/A	Painted X Walk1?	No		Road Slope (%)	8.3																																																																																																																																																				
	X Walk 1 Direction	To E		Road X Slope (%)	3.6																																																																																																																																																				
	X Walk 1 Width (in)	N/A		Clear Space?	N/A																																																																																																																																																				
	X Walk 1 Slope (%)	8.3	N/A	Clear Space to XWalk (in)	N/A																																																																																																																																																				
	X Walk 1 X Slope (%)	3.6	N/A	Storm Grate/Utility Hazard?	N/A																																																																																																																																																				
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type																																																																																																																																																					
N/A	Any Obstructions?	N/A			N/A																																																																																																																																																				
	Obstruction Type		Yes	Surface Condition? (G/P)	Good																																																																																																																																																				
			N/A	Curb Slope (%)	7.1																																																																																																																																																				
Total Cost:		\$	1600.00																																																																																																																																																						

