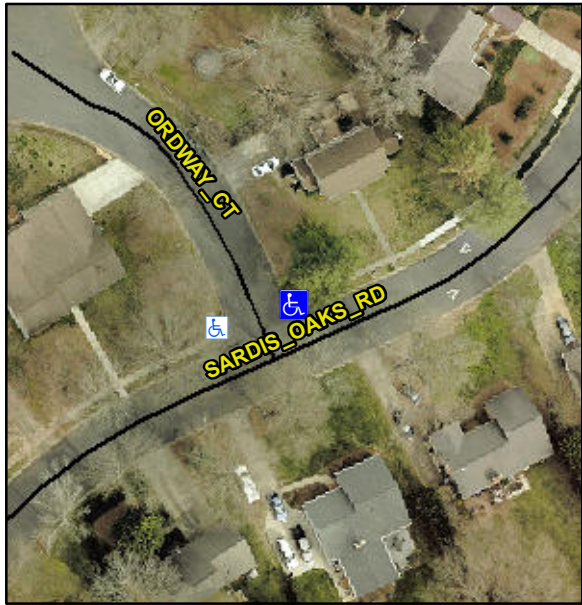


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 21612	Main Street: ORDWAY_CT	Cross Street: SARDIS_OAKS_RD	Location: NE
ADA ID: DFF9DCE99E12	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 13.75	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance							
	Possible Solutions:	Compliance		Description	Data	Compliance		Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	49.0	No	Ramp Slope (%)	9.5		
		Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.6		
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
Surveyor Notes: N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A			
	PROW/ADA: R304.2.2, R304.5.3	N/A	Shared Landing?	N/A					
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
			X Walk 1 Direction	To W		X Walk 2 Direction	To S		
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
			X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	5.1		
			X Walk 1 X Slope (%)	3.7		X Walk 2 X Slope (%)	1.4		
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
Street 1 Name ORDWAY CT Stop Condition-Street 2 StopSign Street 2 Name SARDIS OAKS RD Stop Condition-Street 1 None		Road Slope (%)	2.6	N/A	Clear Space?	N/A			
		Road X Slope (%)	4.6	N/A	Clear Space to XWalk (in)	N/A			
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A			
		Obstruction Type			Storm Grate/Utility Type				
				N/A		N/A			
				Yes	Surface Condition? (G/P)	Good			
Total Cost:		\$	3200.00						

