


Intersection ID: 15386	Main Street: ALTONDALE_AV	Cross Street: PROVIDENCE_RD	Location:	SE
ADA ID: E05EC78E36E0	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance															
	Possible Solutions:		Compliance			Description			Data	Compliance			Description			Data		
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)						95.0	Yes	Ramp Slope (%)						7.0
			No	Ramp Width (in)						40.0	Yes	Ramp XSlope (%)						0.7
			N/A	Flare Type LT						N/A	N/A	Flare Type RT						N/A
			N/A	Flare Slope LT (%)						N/A	N/A	Flare Slope RT (%)						N/A
			N/A	Flare Traversable LT?						N/A	N/A	Flare Traversable RT?						N/A
			N/A	Landing Length (in)						N/A	N/A	DWS Provided?						N/A
			N/A	Landing Width (in)						N/A	N/A	DWS Contrast?						N/A
			N/A	Landing Slope (%)						N/A	N/A	DWS Length (in)						N/A
			N/A	Landing X Slope (%)						N/A	N/A	DWS Full Width?						N/A
		N/A	Landing Curb? (Y/N)						N/A	N/A	DWS Offset (in)						N/A	
		N/A	Shared Landing?						N/A									
		N/A	Gutter Ponding?						N/A	N/A	Gutter Slope (%)						N/A	
		N/A	Gutter Lip Ht (in)						N/A	N/A	Gutter X Slope (%)						N/A	
		N/A	Painted X Walk1?						No	N/A	Painted X Walk2?						No	
			X Walk 1 Direction						To NE	X Walk 2 Direction						To W		
		N/A	X Walk 1 Width (in)						N/A	N/A	X Walk 2 Width (in)						N/A	
			X Walk 1 Slope (%)						6.3	X Walk 2 Slope (%)						2.4		
			X Walk 1 X Slope (%)						4.7	X Walk 2 X Slope (%)						3.7		
		N/A	Ramp inside XWalk1?						N/A	N/A	Ramp inside XWalk2?						N/A	
			Road Slope (%)						1.1	N/A	Clear Space?						N/A	
			Road X Slope (%)						6.0	N/A	Clear Space to XWalk (in)						N/A	
		N/A	Any Obstructions?						N/A	N/A	Storm Grate/Utility Hazard?						N/A	
			Obstruction Type							Storm Grate/Utility Type								
									N/A									
										Yes	Surface Condition? (G/P)						Good	

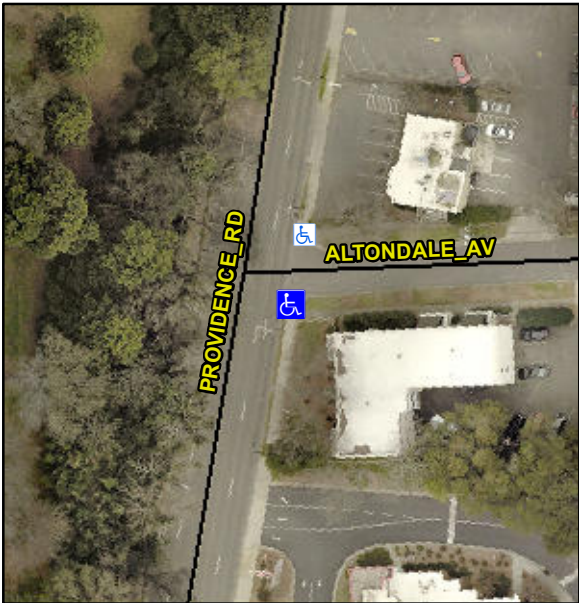