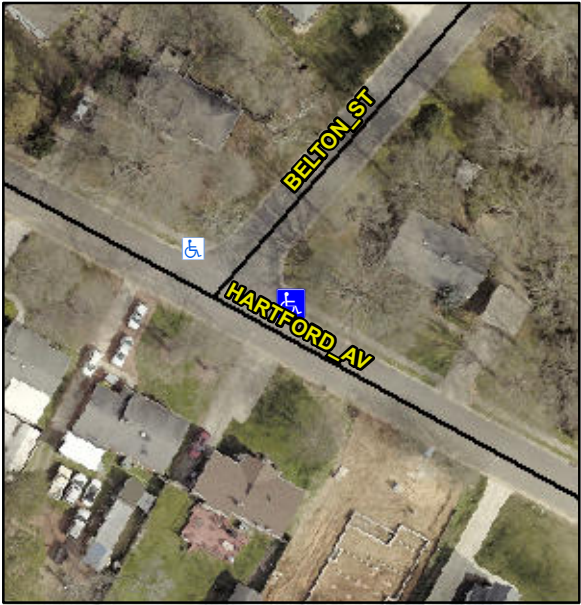


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 16191	Main Street: BELTON_ST	Cross Street: HARTFORD_AV	Location: E
ADA ID: E0A22B1EFF0A	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	<p>Possible Solutions:</p> <p><b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove &amp; Replace Gutter.</b></p>	Compliance	Description	Data	
	<p>Surveyor Notes:</p> <p><b>N/A</b></p>				
	<p>PROW/ADA:</p> <p><b>Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.4</b></p>				
Street 1 Name	BELTON ST				
Stop Condition-Street 2	StopSign				
Street 2 Name	HARTFORD AV				
Stop Condition-Street 1	None				
Total Cost:	\$ 3950.00				

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	59.0	Yes	Ramp Slope (%)	7.3
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.8	Yes	Flare Slope RT (%)	1.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.2		X Walk 2 Slope (%)	3.4
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	4.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9	N/A	Clear Space?	Yes
	Road X Slope (%)	6.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

