


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14442	Main Street: N_SHARON_AMITY_RD	Cross Street: CENTRAL_AV	Location: N
ADA ID: E0EFCDD2C0B7	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

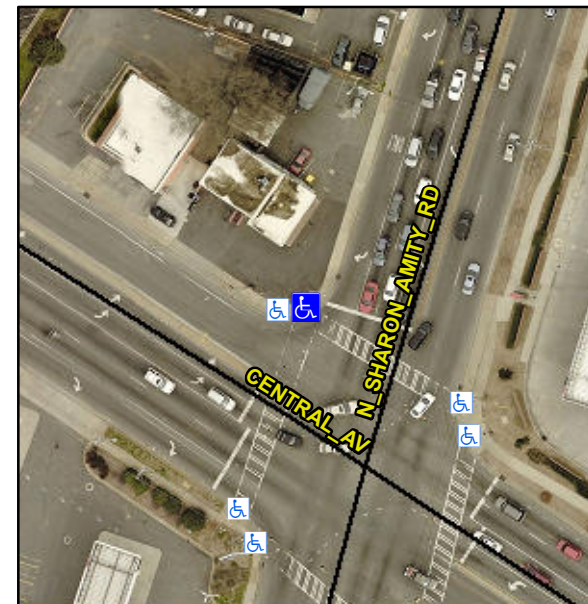

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R304.2.1, R304.2.2-Perp,
R304.3.2-Para**

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	53.0	N/A	Ramp Length RT (in)	57.5
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	60.5
Yes	Ramp Slope LT (%)	5.0	Yes	Ramp Slope RT (%)	6.9
No	Ramp XSlope LT (%)	2.3	No	Ramp XSlope RT (%)	3.3
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	39.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.3	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	2.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	103.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	22.4

