

# Access Compliance Report

## Public Rights-of-Way


### (Curb Ramps)

Intersection ID: 3448 Main Street: W W T HARRIS BV TO I-77 RA SB Street: I-77 TO W W T HARRIS BV RA SB Location: NE

ADA ID: E0FF296013D6 Ramp Type: Para Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

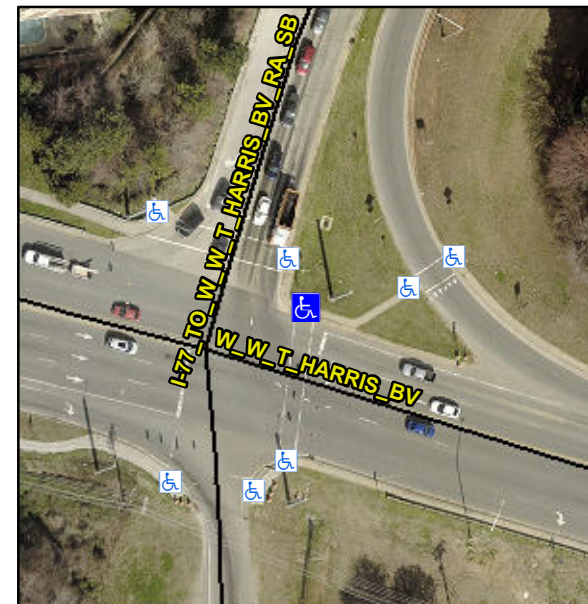

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.3.2**

Street 1 Name **W W T HARRIS BV**  
 Stop Condition-Street 1 **Signal**  
 Street 2 Name **N/A**  
 Stop Condition-Street 2 **N/A**

Total Cost: \$ **1600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	72.0	N/A	Ramp Length RT (in)	72.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.0
Yes	Ramp Slope LT (%)	7.8	No	Ramp Slope RT (%)	9.2
Yes	Ramp XSlope LT (%)	1.2	Yes	Ramp XSlope RT (%)	0.9
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	118.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.7

