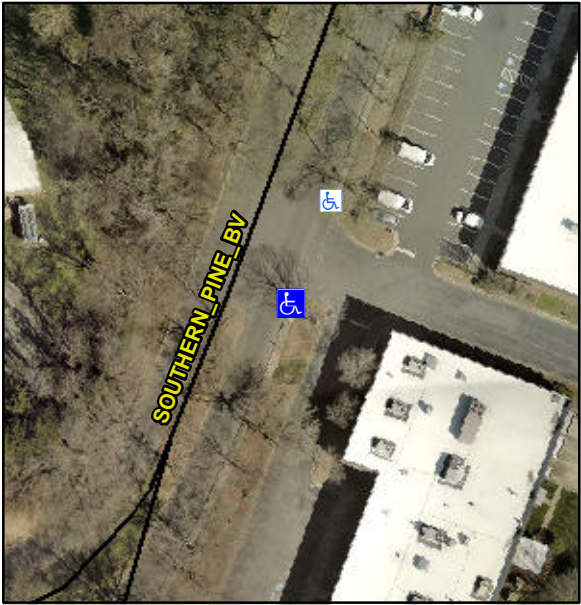


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10038458	Main Street: SOUTHERN_PINE_BV	Cross Street: N/A	Location: S
ADA ID: E0FF42647241	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 21.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.2
		No	Ramp Width (in)	40.0	No	Ramp XSlope (%)	5.8
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To N		X Walk 2 Direction	To W
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	2.0
			X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	0.0
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3</p>			Road Slope (%)	0.8	N/A	Clear Space?	N/A
			Road X Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good

Street 1 Name	ENTRANCE
Stop Condition-Street 2	None
Street 2 Name	Southern Pine
Stop Condition-Street 1	None

Total Cost: \$ 3200.00

