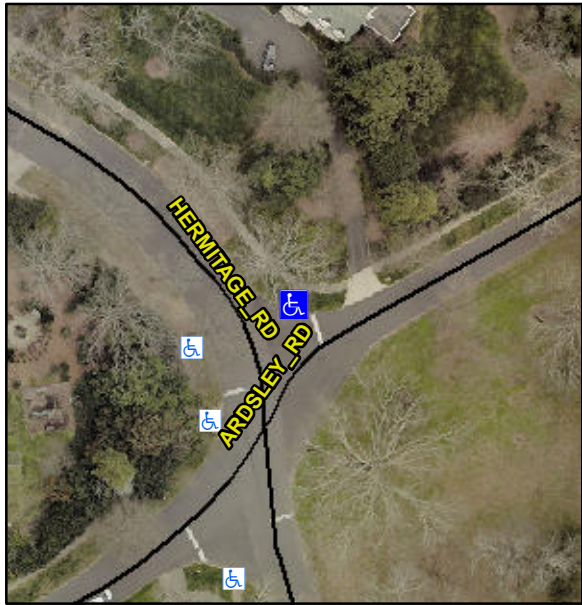


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15220	Main Street: ARDSLEY_RD	Cross Street: HERMITAGE_RD	Location:	N
ADA ID: E11FDCD82914	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	139.0	No	Ramp Slope (%)	18.9
			Yes	Ramp Width (in)	49.0	Yes	Ramp XSlope (%)	2.0
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	N/A		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To W		X Walk 2 Direction	To S
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	2.1		X Walk 2 Slope (%)	9.0
				X Walk 1 X Slope (%)	8.6		X Walk 2 X Slope (%)	2.3
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
PROW/ADA:	Not Found, R304.2.2			Road Slope (%)	6.3	N/A	Clear Space?	N/A
				Road X Slope (%)	7.7	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00						

Street 1 Name	HERMITAGE RD
Stop Condition-Street 2	StopSign
Street 2 Name	ARDSLEY RD
Stop Condition-Street 1	StopSign

Total Cost: \$ 3200.00

