

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9934	Main Street: N_PINE_ST	Cross Street: W_26TH_ST	Location: N
ADA ID: E1D04C8AC0EA	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 17.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

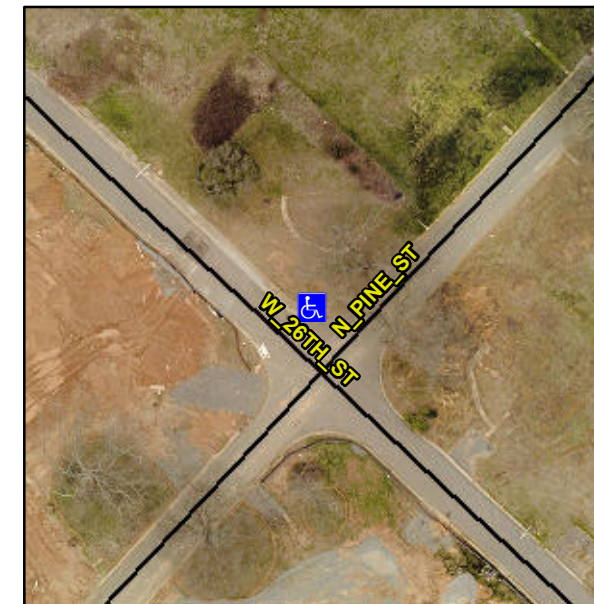

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

VEGETATION OVERGROWTH, NO RT SW

PROW/ADA:

Not Found, R304.5.3, R305.1.4, R305.2, R302.7, R302.7.2

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.0	Yes	BlendTrans Slope (%)	3.3
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	4.5
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	10.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.1
No	Gutter Lip Ht (in)	1.5	No	Gutter X Slope (%)	5.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.9		Clear Space?	Yes
	Road X Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	14.9

Street 1 Name	W 26TH ST
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

