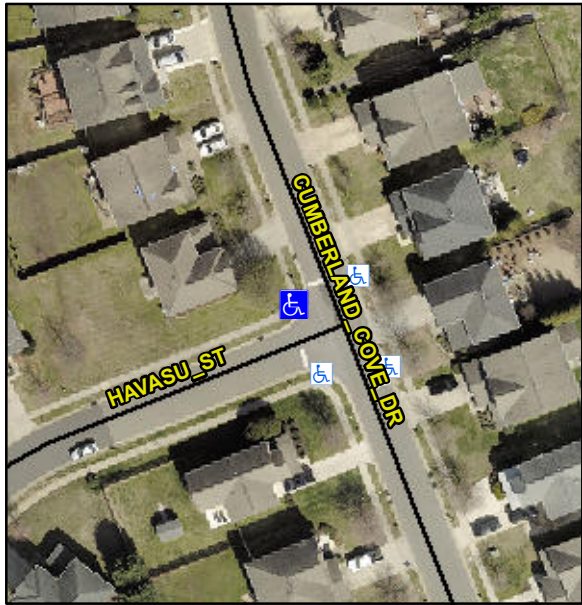


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46753	Main Street: HAVASU_ST	Cross Street: CUMBERLAND_COVE_DR	Location: NW
ADA ID: E2545BF06682	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 30	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance						
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	11.5
			No	Ramp Width (in)	33.0	Yes	Ramp XSlope (%)	1.9
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A			Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA: R304.5.1, R304.2.2		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To SE		X Walk 2 Direction	To NE	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	1.9	
			X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	0.4	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	1.6	N/A	Clear Space?	N/A	
Total Cost:			Road X Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	

