


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28385	Main Street: COMMONS_CROSSING_DR	Cross Street: HIGHLANDS_CROSSING_DR	Location: SW
ADA ID: E26C98B2FCC6	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 22.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

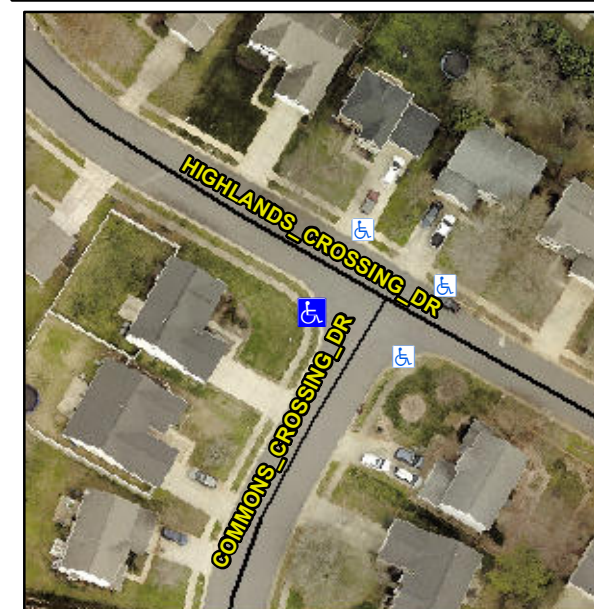

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.2
Yes	Ramp Width (in)	60.0	Yes	Ramp XSlope (%)	1.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	8.0	N/A	Flare Slope RT (%)	3.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	47.0	No	DWS Provided?	No
Yes	Landing Width (in)	60.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.6	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	9.9
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	0.5
	X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	1.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.0	N/A	Clear Space?	Yes
	Road X Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name COMMONS CROSSING DR
 Stop Condition-Street 2 StopSign
 Street 2 Name HIGHLANDS CROSSING DR
 Stop Condition-Street 1 None

