


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 6475	Main Street: CAPPS_HILL_MINE_RD	Cross Street: FIRESTONE_DR	Location: S
ADA ID: E28D9F9F5FDB	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 21.25			

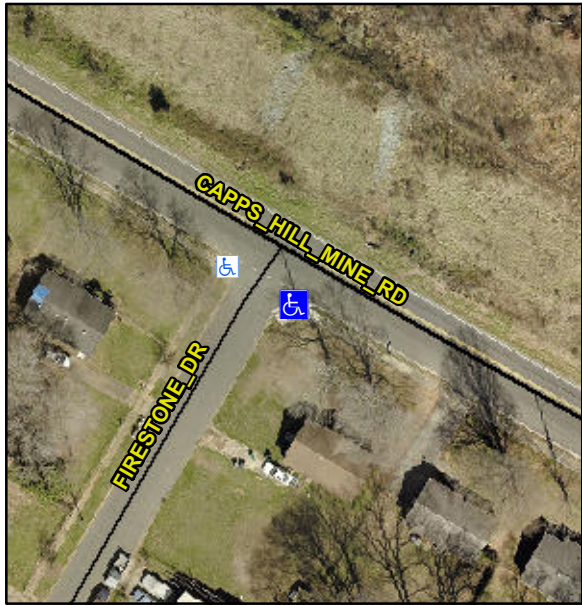

Street 1 Name

FIRESTONE DR

Stop Condition-Street 2

StopSign

Street 2 Name

N/A

Stop Condition-Street 1

N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2

Total Cost:

\$

1850.00

Compliance		Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.0	No	Ramp Slope (%)	9.7	
No	Ramp Width (in)	46.5	Yes	Ramp XSlope (%)	2.0	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	2.0	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	1.3		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	49.0	No	Ramp Slope (%)	9.7
No	Ramp Width (in)	46.5	Yes	Ramp XSlope (%)	2.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	2.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

