


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 28914	Main Street: PINEVILLE-MATTHEWS_RD	Cross Street: SPRINGBANK_LN	Location: NE
ADA ID: E2C9366C505B	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 26.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

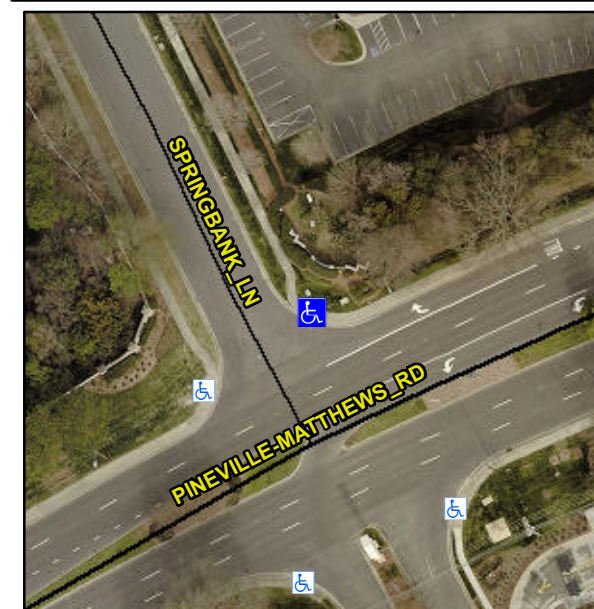

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**DAMAGED DWS, LT RP < 5%**

PROW/ADA:

**R304.5.3, R304.3.2**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	64.0	N/A	Ramp Length RT (in)	64.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.0
Yes	Ramp Slope LT (%)	2.9	No	Ramp Slope RT (%)	19.7
No	Ramp XSlope LT (%)	4.2	Yes	Ramp XSlope RT (%)	1.9
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	3.9
	X Walk 1 X Slope (%)	8.7		X Walk 2 X Slope (%)	3.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.7	N/A	Clear Space?	N/A
	Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	6.8

Street 1 Name **SPRINGBANK LN**  
 Stop Condition-Street 1 **StopSign**  
 Street 2 Name **PINEVILLE-MATTHEWS RD**  
 Stop Condition-Street 2 **None**

