

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 43934	Main Street: ALBEMARLE_RD	Cross Street: CIRCUMFERENTIAL_RD	Location: SE
ADA ID: E2E4CAD0BEA3	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

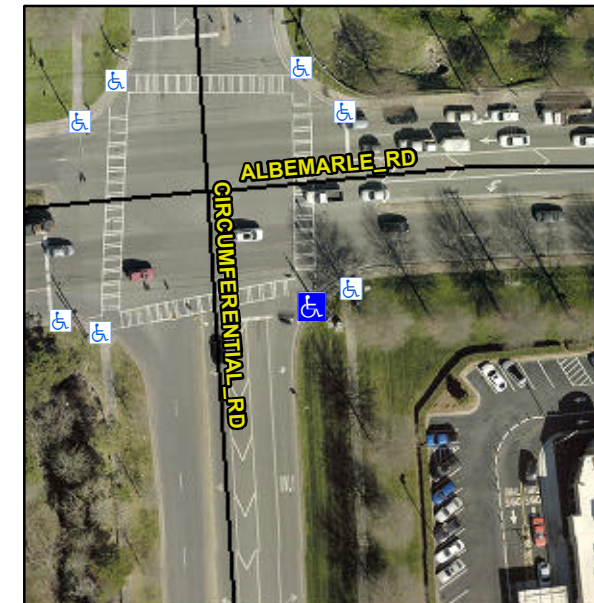

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	62.0	Yes	BlendTrans Slope (%)	3.7
No	Ramp Width (in)	46.0	No	BlendTrans XSlope (%)	3.5
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
	X Walk 1 Width (in)	115.0		X Walk 2 Width (in)	87.0
	X Walk 1 Slope (%)	5.1		X Walk 2 Slope (%)	1.9
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	4.1
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.1		Clear Space?	N/A
	Road X Slope (%)	4.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good
		No		Curb Slope (%)	6.7

Street 1 Name ALBEMARLE RD
 Stop Condition-Street 1 Signal
 Street 2 Name CIRCUMFERENTIAL RD
 Stop Condition-Street 2 Signal

