


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 54301	Main Street: GOLF_LINKS_DR	Cross Street: PROVIDENCE_FARM_LN	Location: SW
ADA ID: E322A9E78809	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 13.75	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.2.2, R304.5.3				
	Street 1 Name	GOLF LINKS DR			
	Stop Condition-Street 1	StopSign			
	Street 2 Name	N/A			
	Stop Condition-Street 2	N/A			
Total Cost:		\$	1600.00		
		Compliance	Description	Data	Compliance Description Data
		N/A	Ramp Length (in)	64.0	N/A Grade Break? N/A
		Yes	Ramp Width (in)	77.0	N/A Grade Break Slope (%) 0.0
		No	Ramp Slope (%)	11.3	N/A Grade Break XSlope (%) 0.0
		No	Ramp XSlope (%)	2.5	
		N/A	Flare Type LT	N/A	N/A Flare Type RT N/A
		N/A	Flare Slope LT (%)	N/A	N/A Flare Slope RT (%) 0.0
		N/A	Flare Traversable LT?	N/A	N/A Flare Traversable RT? N/A
		N/A	Landing Length (in)	0.0	N/A DWS Provided? N/A
		N/A	Landing Width (in)	0.0	N/A DWS Contrast? N/A
		N/A	Landing Slope (%)	0.0	N/A DWS Length (in) N/A
		N/A	Landing X Slope (%)	0.0	N/A DWS Full Width? N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A DWS Offset LT (in) N/A
		N/A	Shared Landing?	N/A	N/A DWS Offset RT (in) N/A
		N/A	Gutter Ponding?	0.0	N/A Gutter Slope (%) N/A
		N/A	Gutter Lip Ht (in)	0.0	N/A Gutter X Slope (%) N/A
		N/A	Painted X Walk1?	No	Road Slope (%) 2.4
			X Walk 1 Direction	To NE	Road X Slope (%) 2.4
			X Walk 1 Width (in)	N/A	Clear Space? N/A
			X Walk 1 Slope (%)	2.4	N/A Clear Space to XWalk (in) N/A
			X Walk 1 X Slope (%)	2.4	N/A Storm Grate/Utility Hazard? N/A
		N/A	Ramp inside XWalk1?	N/A	Storm Grate/Utility Type
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		Yes Surface Condition? (G/P) Good
				N/A	N/A Curb Slope (%) 4.1

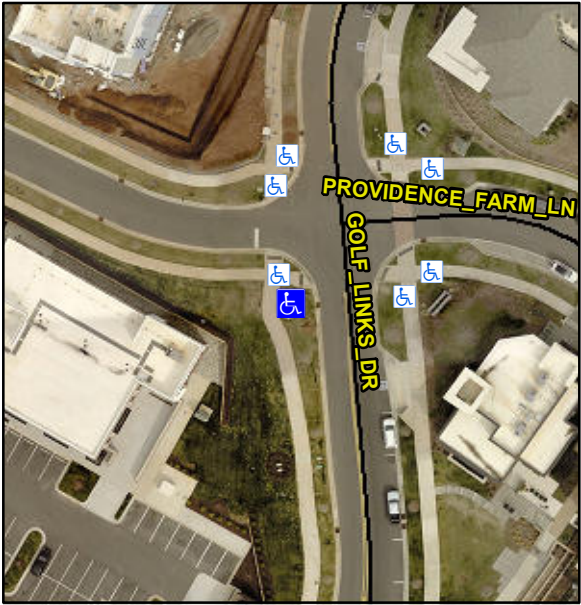