

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 17609	Main Street: E_WOODLAWN_RD	Cross Street: STERLING_DR	Location: NW
ADA ID: E393662E69CA	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

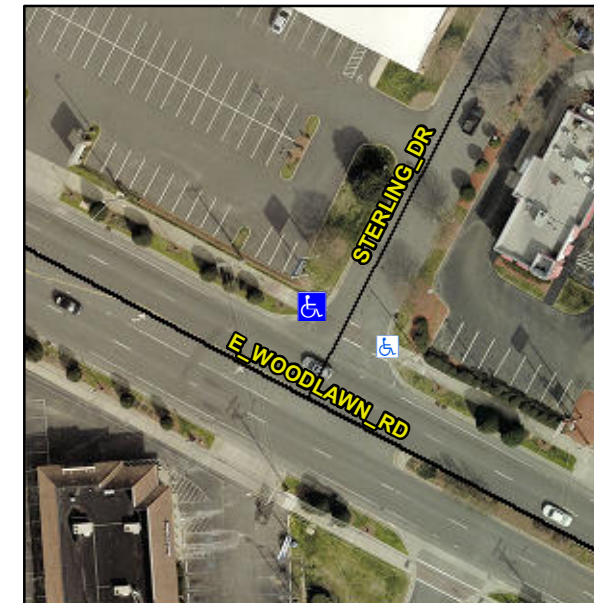

Possible Solutions:

Remove & Replace Detectable Warning System. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R305.1.4, R304.5.4, R304.5.3

Total Cost: \$ 1550.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	55.0	Yes	BlendTrans Slope (%)	3.3
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.5
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
N/A	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
N/A	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
N/A	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	105.0
	X Walk 1 Slope (%)	4.5		X Walk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	3.1
N/A	Ramp inside XWalk1?	N/A	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.4		Clear Space?	Yes
	Road X Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	2.1

Street 1 Name E WOODLAWN RD

Stop Condition-Street 1 None

Street 2 Name STERLING DR

Stop Condition-Street 2 StopSign

