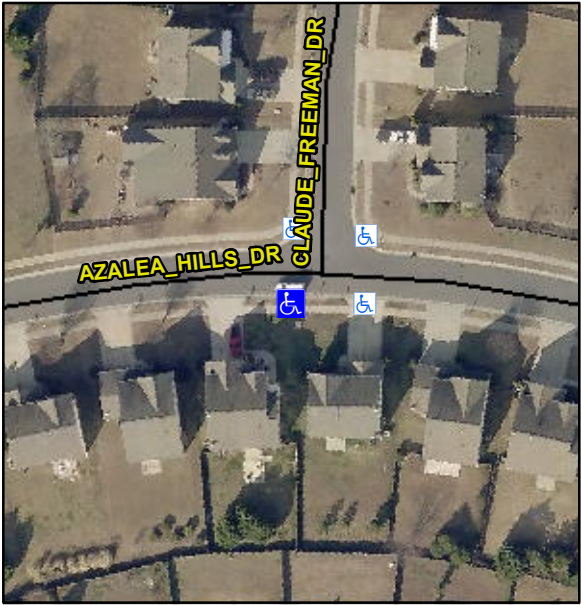



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46819	Main Street: CLAUDE FREEMAN DR	Cross Street: AZALEA HILLS DR	Location: SW
ADA ID: E3A51B619B15	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	49.0
			Yes	Ramp Width (in)	49.0
			N/A	Flare Type LT	Sloped
			N/A	Flare Slope LT (%)	6.3
			N/A	Flare Traversable LT?	Yes
			Yes	Landing Length (in)	49.0
			Yes	Landing Width (in)	63.5
			Yes	Landing Slope (%)	0.7
			Yes	Landing X Slope (%)	0.7
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R305</p>			N/A	Flare Type RT	N/A
			Yes	Flare Slope RT (%)	9.0
			N/A	Flare Traversable RT?	Yes
			No	DWS Provided?	No
			N/A	DWS Contrast?	No
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	No
			N/A	DWS Offset (in)	N/A
			No	Gutter Ponding?	No
			Yes	Gutter Lip Ht (in)	0.0
<p>Total Cost:</p> <p>\$ 1850.00</p>			N/A	Painted X Walk1?	No
			N/A	X Walk 1 Direction	To N
			N/A	X Walk 1 Width (in)	N/A
			N/A	X Walk 1 Slope (%)	2.7
			N/A	X Walk 1 X Slope (%)	1.2
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			Yes	Any Obstructions?	No
				Obstruction Type	
			N/A	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			N/A	X Walk 2 Slope (%)	N/A
			N/A	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	Yes
			N/A	Clear Space to XWalk (in)	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good