


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 21096	Main Street: FOLGER_DR	Cross Street: OWENBY_CT	Location:	N
ADA ID: E3E4B37919F4	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5.25
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

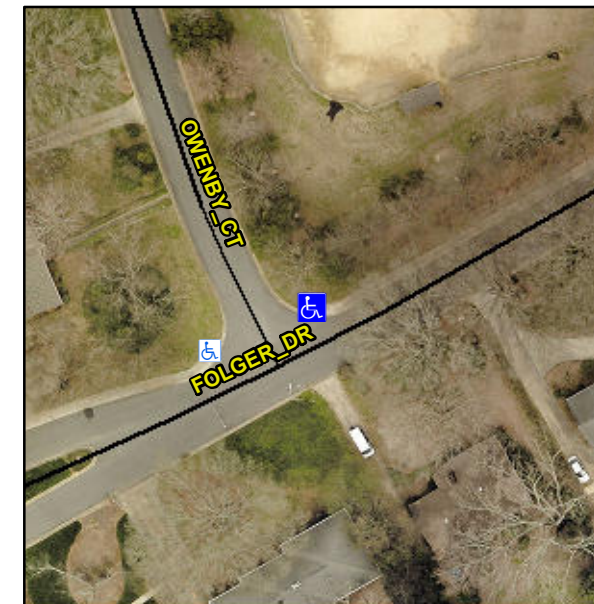

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	27.5	N/A	Ramp Length RT (in)	27.0
Yes	Ramp Width LT (in)	62.0	Yes	Ramp Width RT (in)	62.0
Yes	Ramp Slope LT (%)	6.9	Yes	Ramp Slope RT (%)	5.8
Yes	Ramp XSlope LT (%)	1.8	No	Ramp XSlope RT (%)	2.8
Yes	Landing Length (in)	61.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.3	Yes	DWS Length (in)	25.0
Yes	Landing X Slope (%)	0.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	7.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	5.5
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	3.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.2	N/A	Clear Space?	Yes
	Road X Slope (%)	3.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	4.2

