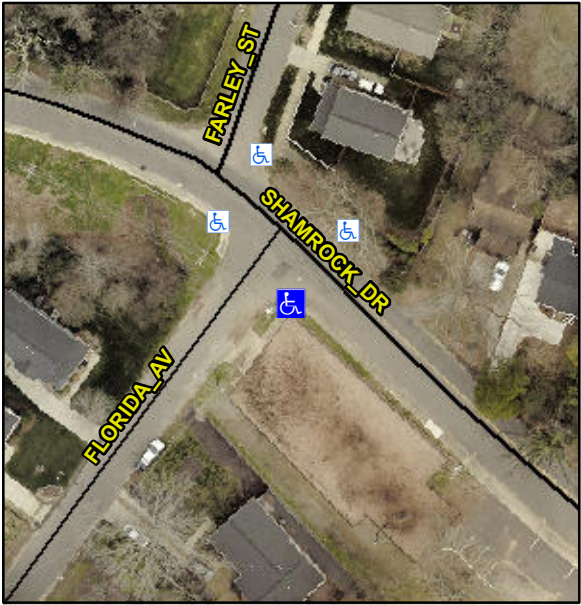


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11234	Main Street: FLORIDA_AV	Cross Street: SHAMROCK_DR	Location: S
ADA ID: E439C4840B4D	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 37.5	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:	Compliance	Description	Data	
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	57.0	No
		Yes	Ramp Width (in)	48.0	No
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2, R304.5.3</p>		N/A	Flare Type RT	N/A	N/A
		N/A	Flare Slope RT (%)	N/A	N/A
		N/A	Flare Traversable RT?	N/A	N/A
		N/A	DWS Provided?	N/A	N/A
		N/A	DWS Contrast?	N/A	N/A
		N/A	DWS Length (in)	N/A	N/A
		N/A	DWS Full Width?	N/A	N/A
		N/A	DWS Offset (in)	N/A	N/A
		N/A	Shared Landing?	N/A	N/A
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To NE	To NW
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	5.2	X Walk 2 Slope (%)
			X Walk 1 X Slope (%)	0.5	X Walk 2 X Slope (%)
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	7.3	N/A
			Road X Slope (%)	9.9	N/A
		N/A	Any Obstructions?	N/A	N/A
Total Cost:		\$	3200.00		
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P)
					Good

