

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 8373 Main Street: AUGUSTA\_ST Cross Street: LASALLE\_ST Location: NE

ADA ID: E46D26022FAF Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

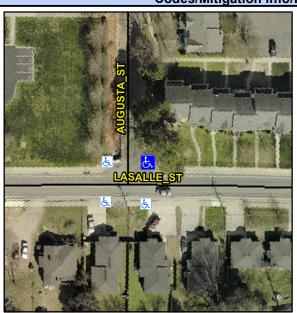

Street 1 Name
AUGUSTA ST
Stop Condition-Street 2
StopSign
Street 2 Name
LASALLE ST
Stop Condition-Street 1
None

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.1, R304.2.2

Compliance Description Data Compliance Description Data No N/A Ramp Length (in) 60.0 Ramp Slope (%) 14.9 Ramp XSlope (%) No Ramp Width (in) 39.0 Yes 0.7 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A N/A N/A Flare Slope RT (%) N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A N/A N/A **DWS Provided?** N/A Landing Length (in) N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A N/A Landing Slope (%) DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A **Gutter Ponding?** N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) 1.5 N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To W X Walk 2 Direction To S N/A N/A X Walk 1 Width (in) N/A X Walk 2 Width (in) N/A X Walk 1 Slope (%) 1.7 X Walk 2 Slope (%) 1.4 X Walk 1 X Slope (%) 0.5 X Walk 2 X Slope (%) 0.4 N/A N/A N/A Ramp inside XWalk2? Ramp inside XWalk1? N/A Road Slope (%) 1.5 N/A Clear Space? N/A N/A Road X Slope (%) Clear Space to XWalk (in) N/A 1.4 N/A N/A Any Obstructions? N/A Storm Grate/Utility Hazard? N/A **Obstruction Type** Storm Grate/Utility Type N/A N/A

Yes

Surface Condition? (G/P)

Good





Total Cost:



3200.00