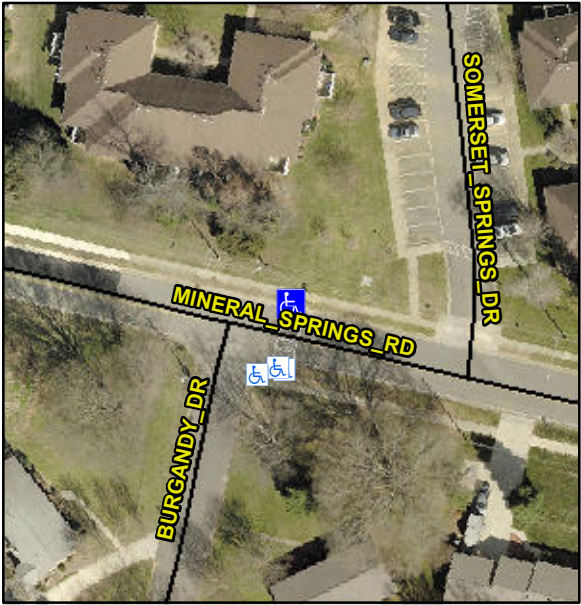


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 6462	Main Street: BURGANDY_DR	Cross Street: MINERAL_SPRINGS_RD	Location: E
ADA ID: E4B7AA96BC08	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	Compliance
	Remove & Replace Entire Ramp.		Description			Description
			Data			Data
			N/A	Ramp Length (in)	48.0	Yes
			Yes	Ramp Width (in)	48.0	Yes
			N/A	Flare Type LT	Sloped	N/A
			N/A	Flare Slope LT (%)	9.3	N/A
			N/A	Flare Traversable LT?	No	N/A
			No	Landing Length (in)	46.5	Yes
			Yes	Landing Width (in)	56.0	Yes
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.1, R302.7</p>			Yes	Landing Slope (%)	1.3	Yes
			Yes	Landing X Slope (%)	3.7	Yes
			N/A	Landing Curb? (Y/N)	No	Yes
			N/A	Shared Landing?	No	
			No	Gutter Ponding?	Yes	Yes
			Yes	Gutter Lip Ht (in)	0.0	Yes
			N/A	Painted X Walk1?	Yes	N/A
				X Walk 1 Direction	To S	
			N/A	X Walk 1 Width (in)	111.0	N/A
				X Walk 1 Slope (%)	1.6	
				X Walk 1 X Slope (%)	4.1	
			Yes	Ramp inside XWalk1?	Yes	N/A
				Road Slope (%)	N/A	N/A
				Road X Slope (%)	N/A	N/A
			Yes	Any Obstructions?	No	Yes
				Obstruction Type		
					N/A	N/A
			Yes	Surface Condition? (G/P)		Good

Street 1 Name	MINERAL SPRINGS RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 1850.00

