


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 12611	Main Street: S_CHURCH_ST	Cross Street: W_STONEWALL_ST	Location: N
ADA ID: E4C1581F6C9F	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 22.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

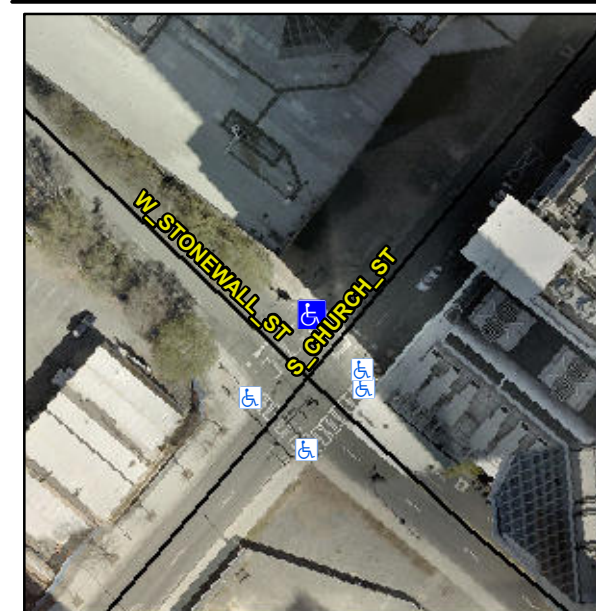

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.3, R305.2, R302.7.2, R304.5.4**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	60.0	Yes	Ramp Slope (%)	6.3
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.4	No	Flare Slope RT (%)	12.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.7
No	Gutter Lip Ht (in)	4.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	118.0	N/A	X Walk 2 Width (in)	111.0
	X Walk 1 Slope (%)	1.6		X Walk 2 Slope (%)	5.3
	X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	2.1
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.2	N/A	Clear Space?	Yes
	Road X Slope (%)	4.8	Yes	Clear Space to XWalk (in)	90.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

