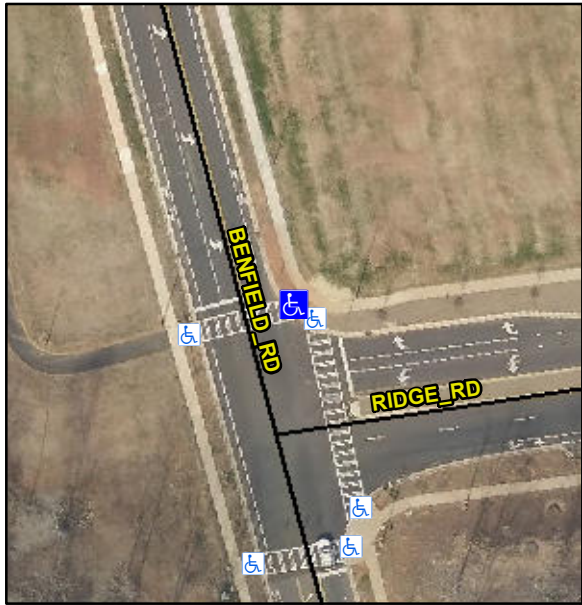


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|------------------------|--------------------------|-------------------------|------------------------|
| Intersection ID: 45310 | Main Street: BENFIELD_RD | Cross Street: RIDGE_RD | Location: NE |
| ADA ID: E53028D2CFD4 | Ramp Type: Perp | Initial Pass/Fail: Fail | Overall Compliance: No |
| | | Severity Score: 12.5 | |

| Codes/Mitigation Info/Possible Solution | | | Field Measurements/Component Compliance | | | | | |
|--|--|-----|---|-----------------------|-------------|-----------------------------|-----------------------|-------------|
|  | Possible Solutions: | | Compliance | Description | Data | Compliance | Description | Data |
| | Remove & Replace Entire Ramp. | | N/A | Ramp Length (in) | 66.0 | No | Ramp Slope (%) | 10.4 |
| | | | Yes | Ramp Width (in) | 72.0 | Yes | Ramp XSlope (%) | 0.6 |
| | | | N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| | | | N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| | | | N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| | | | N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| | | | N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| | | | N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| | | | N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2</p> | | | N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| | | | N/A | Shared Landing? | N/A | | | |
| | | | N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| | | | N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| | | | N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | | | | X Walk 1 Direction | To W | | X Walk 2 Direction | N/A |
| | | | N/A | X Walk 1 Width (in) | 120.0 | N/A | X Walk 2 Width (in) | N/A |
| | | | | X Walk 1 Slope (%) | 1.8 | | X Walk 2 Slope (%) | N/A |
| | | | | X Walk 1 X Slope (%) | 2.2 | | X Walk 2 X Slope (%) | N/A |
| | | | N/A | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A |
| | | | Road Slope (%) | N/A | N/A | Clear Space? | N/A | |
| | | | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A | |
| | | N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A | |
| | | | Obstruction Type | | | Storm Grate/Utility Type | | |
| | | | | | N/A | | N/A | |
| | | | | | Yes | Surface Condition? (G/P) | Good | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

