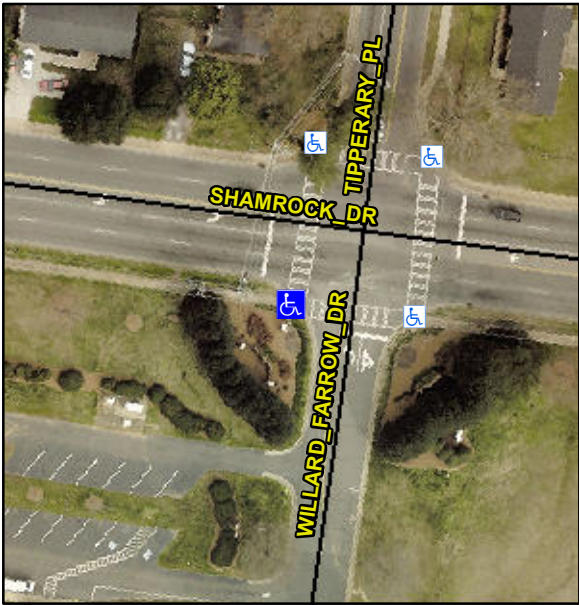


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11567	Main Street: SHAMROCK_DR	Cross Street: TIPPERARY_PL	Location: SW
ADA ID: E5BDA4D0FB64	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 35	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance		Description	Data	Compliance		Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	61.0	Yes	Ramp Slope (%)	6.9		
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2		
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	5.0	Yes	Flare Slope RT (%)	7.9		
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes		
			No	Landing Length (in)	N/A	No	DWS Provided?	No		
			No	Landing Width (in)	N/A	N/A	DWS Contrast?	No		
			No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
			No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No		
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A		
PROW/ADA:		Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R302.7.2	N/A	Shared Landing?	N/A					
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.8		
			No	Gutter Lip Ht (in)	3.0	Yes	Gutter X Slope (%)	0.8		
			N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes		
				X Walk 1 Direction	To E		X Walk 2 Direction	To N		
			N/A	X Walk 1 Width (in)	107.5	N/A	X Walk 2 Width (in)	107.0		
				X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	0.7		
				X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	0.3		
			Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes		
				Road Slope (%)	0.8	N/A	Clear Space?	Yes		
				Road X Slope (%)	0.3	Yes	Clear Space to XWalk (in)	64.0		
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		
				Obstruction Type			Storm Grate/Utility Type			
					N/A			N/A		
						Yes	Surface Condition? (G/P)	Good		
Total Cost:		\$ 3200.00								

