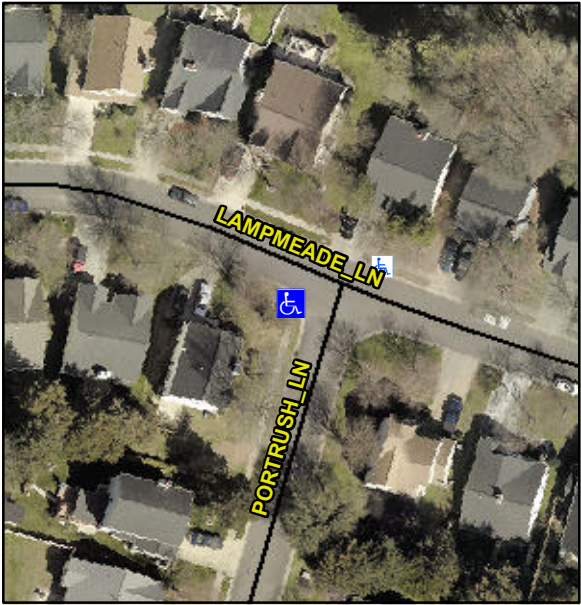


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 23921	Main Street: LAMPMEADE_LN	Cross Street: PORTRUSH_LN	Location: SW
ADA ID: E66A7CFC0E56	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length (in)	95.0	<b>Yes</b>
			No	Ramp Width (in)	47.0	<b>Yes</b>
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1</b></p>			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	N/A	N/A
			N/A	Flare Traversable RT?	N/A	N/A
			N/A	DWS Provided?	N/A	N/A
			N/A	DWS Contrast?	N/A	N/A
			N/A	DWS Length (in)	N/A	N/A
			N/A	DWS Full Width?	N/A	N/A
			N/A	DWS Offset (in)	N/A	N/A
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To SE	
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	0.5	
				X Walk 1 X Slope (%)	0.0	
			N/A	Ramp inside XWalk1?	N/A	N/A
				Road Slope (%)	1.0	N/A
				Road X Slope (%)	0.8	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
Total Cost: \$ 3200.00					N/A	N/A
					Yes	Surface Condition? (G/P) Good

